

11296

11296

Form 504

U. S. DEPARTMENT OF COMMERCE
COAST AND GEODETIC SURVEY

DESCRIPTIVE REPORT

Type of Survey Shoreline (Photogrammetric)

Field No. ^{PH}6117 Office No. T-11296

LOCALITY

State ALASKA

General locality Cordova Bay

Locality Jackson Island

1948-1952

CHIEF OF PARTY
F. R. Gossett, Chief of Field Party
J. Bowie, Chief of Field Party
~~E. H. Kirsch, Baltimore District Officer~~

LIBRARY & ARCHIVES

DATE _____

DATA RECORD

T -11296

Project No. (II): ^{PH} 6117 Quadrangle Name (IV):

Field Office (II): USC&GE Ship HODGSON Chief of Party: F. R. Gossett, J. Bowle

Photogrammetric Office (III): Baltimore, Md. Officer-in-Charge: E. H. Kirsch

Instructions dated (II) (III):
Field: 17 Mar. 1953 Office: 7 Dec. 1953 Copy filed in Division of
8 Jan. 1954 11 Oct. 1954 Photogrammetry (IV)

Method of Compilation (III): Graphic

Manuscript Scale (III): 1:10,000 Stereoscopic Plotting Instrument Scale (III):

Scale Factor (III): 1.000

Date received in Washington Office (IV): 3-17-56 Date reported to Nautical Chart Branch (IV): 3-24-56

Applied to Chart No. Date: Date registered (IV):

Publication Scale (IV): Publication date (IV):

Geographic Datum (III): N.A. 1927 Vertical Datum (III): MHW

Mean sea level except as follows:
Elevations shown as (25) refer to mean high water
Elevations shown as (5) refer to sounding datum
i.e., mean low water or mean lower low water

Reference Station (III): JACK, 1907

Lat.: 54° 58' 33.709" (1042.4 m) Long.: 132° 43' 06.619" (117.7 m) Adjusted
~~Unadjusted~~

Plane Coordinates (IV): State: Alaska Zone: 8

Y= X=

Roman numerals indicate whether the item is to be entered by (II) Field Party, (III) Photogrammetric Office, or (IV) Washington Office.

When entering names of personnel on this record give the surname and initials, not initials only.

Inapplicable

Areas contoured by various personnel
(Show name within area)
(II) (III)

DATA RECORD

Field Inspection by (II): D. L. Campbell, A. C. Haglund
R. C. Munson, J. J. Dermody

Date: 1953 field season
1954 field season

Planetable contouring by (II):

Date:

Completion Surveys by (II):

Date:

Mean High Water Location (III) (State date and method of location): 1953, 1954 dates of photography
Field inspection

Projection and Grids ruled by (IV): A. Riley

Date: 12/16/53

Projection and Grids checked by (IV): C. Hanavich

Date: 12/18/53

Control plotted by (III): J. C. Gregan

Date: 1/19/54

Control checked by (III): R. Glaser

Date: 2/3/54

Radial Plot ~~STEREOSCOPIC~~

Date:

~~CONTROLS~~ by (III): H. R. Rudolph
E. L. Williams

2/19/54
2/1/55

Planimetry

Date:

Stereoscopic Instrument compilation (III):

Contours

Date:

Manuscript delineated by (III): J. Honick

Date: 2/1/55

Photogrammetric Office Review by (III): R. Glaser

Date: 2/4/55

Elevations on Manuscript
checked by (II) (III):

Date:

Camera (kind or source) (III): U. S. Navy single lens
USC&GS nine-lens and single lens camera "0"

PHOTOGRAPHS (III)

Number	Date	Time	Scale	Stage of Tide
SEA 117-109 thru 111	8/13/48	unknown	1:10,000	Unknown
40955 thru 40957	7/8/53	1530	"	6.6' above MLLW
40977 and 40978	"	1554	"	6.0 " "
54-0-67 & 68	6/4/54	1106	"	1.3' below MLLW

Tide (III)

Reference Station: Sitka
Subordinate Station: Kasook Inlet, Sukkwan Island
Subordinate Station:

Ratio of Ranges	Mean Range	Spring Range
	7.7	9.9
1.4	10.5	12.6

Washington Office Review by (IV): D. M. BRANT

Date: JULY 1970

Final Drafting by (IV):

Date:

Drafting verified for reproduction by (IV):

Date:

Proof Edit by (IV):

Date:

Land Area (Sq. Statute Miles) (III): 1

Shoreline (More than 200 meters to opposite shore) (III): 7

Shoreline (Less than 200 meters to opposite shore) (III): 0.9

Control Leveling - Miles (II):

Number of Triangulation Stations searched for (II): 5

Recovered: 5

Identified: 5

Number of BMs searched for (II):

Recovered:

Identified:

Number of Recoverable Photo Stations established (III): None


Number of Temporary Photo Hydro Stations established (III): 4

Remarks:

-5-

SHORELINE MAPPING PROJECT PH - 117

Cordova Bay & Vicinity of S.E. Alaska

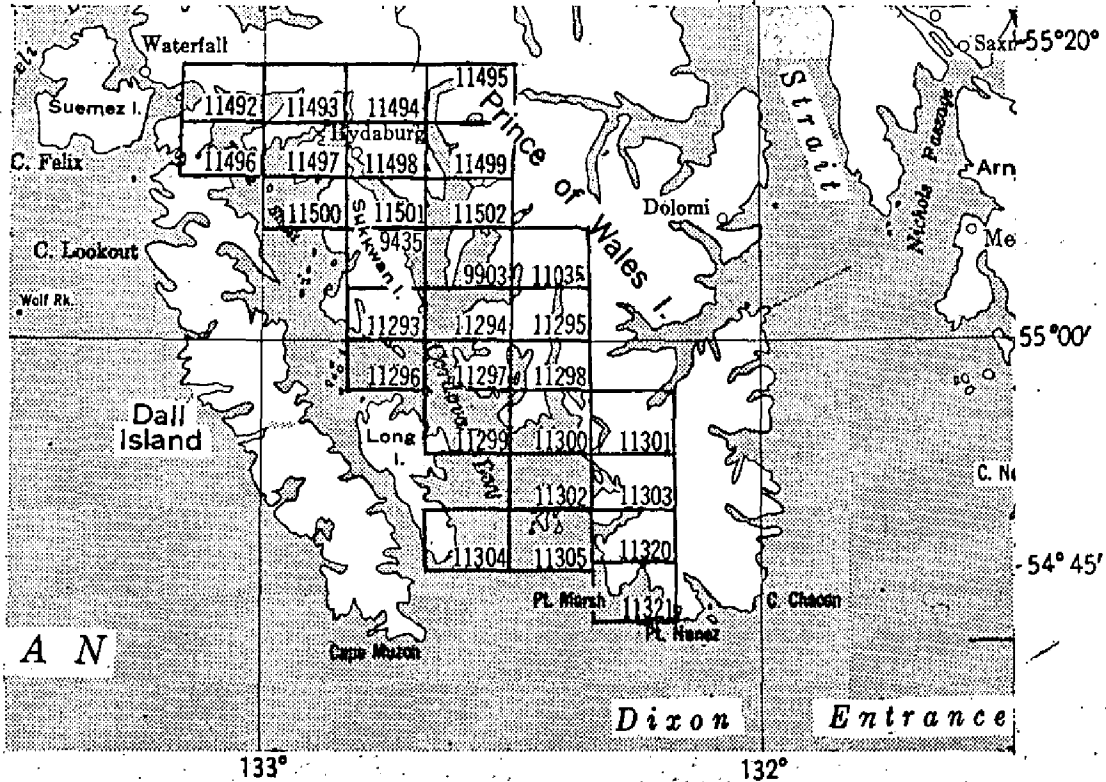

OFFICIAL MILEAGE FOR COST ACCOUNTS					
SHEET NO.	AREA SQ. MILES	LIN. MI. SHORELINE			
9435	13	13	11304	12	12
9903	21	21	11305	37	37
11035	9	9	11320	24	24
11293	20	20	11321	20	20
11294	15	15	11492	24	24
11295	13	13	11493	12	12
11296	14	14	11494	2	2
11297	21	21	11495	16	16
11298	23	23	11496	17	17
11299	16	16	11497	26	26
11300	31	31	11498	8	8
11301	7	7	11499	11	11
11302	18	18	11500	27	27
11303	14	14	11501	17	17
			11502	15	15
			TOTALS	503	503

Summary to Accompany
Descriptive Report
All T-Numbers
PH-117

September 1970

This project is comprised of twenty-nine shoreline surveys compiled at 1:10,000 scale. It covers an area in the vicinity of Cordova Bay in southeast Alaska. The purpose for the compilation of these shoreline surveys was to provide a base for hydrographic survey operations and to update marine charts of the area.

The shoreline area was covered with single-lens and nine-lens photography. Field inspection prior to compilation consisted only of recovery and identification of control. Control was extended by radial plot method in the Baltimore District Office prior to graphic compilation. The shoreline was delineated from office interpretation of the photographs.

Copies of the manuscripts and the ratio photographs were sent to the hydrographic parties (ships HODGSON and PATTON) for hydro support use. Hydro signals were identified and described. Corrections and additions to the shoreline and offshore details were made from field annotated photographs. This has been treated as field inspection throughout this project, but actually it is field edit.

The application of field inspection and photogrammetric office review was done in the Baltimore District Office.

Map Accuracy

The extension of control (radial plots) for the subject maps was considered to be sub-standard in accuracy (refer to radial plot reports). However, the maps were used to provide shoreline and control for hydrographic surveys and were found by the hydrographer to be generally satisfactory for this purpose. A new project is planned for this area.

(continued)

Differences Between Contemporary Hydrographic and Topographic Surveys

Field inspection was done during hydrography (refer to the field inspection report). Where the application of field inspection (additions and corrections) was not applied to the hydrographic surveys, they were called to the attention of the hydrographic verification and review activities by the following means:

1. For an unverified smooth sheet a "Notes to the Verifier" page was inserted in the Hydrographic Survey Descriptive Report.
2. For an unreviewed smooth sheet a "Notes to the Reviewer" page was inserted in the Hydrographic Survey Descriptive Report.
3. For reviewed hydrographic surveys the Chief, Hydrographic Data Branch was notified.

The remaining discrepancies were disposed of in conference with the Hydrographic Review Branch.


Rock Elevations

Differences in some rock elevations were found during final review between a number of the photogrammetric surveys and the contemporary hydrographic surveys. It was decided in conference with the Hydrographic Review Branch that since the rock elevations were from predicted tides they would be removed in most cases from the photogrammetric surveys and the elevations on the hydrographic surveys would be used because of more accurate tide data. An ozalid copy of all manuscripts showing the rock elevations computed from predicted tides will be filed along with available field inspection photographs in the Federal Records Center.

A complete Geographic Names Investigation was made and a final names sheet is a part of this report.

Field records were incomplete at the time of final review. Available field data was used at this time.

A registration manuscript copy for all surveys, except T-11301 and T-11321 which are lost, will be registered in the Bureau Archives under their respective T-numbers.

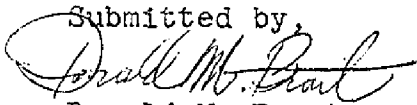Submitted by,

Donald M. Brant

2. AERIAL FIELD INSPECTION

Control station identification was made in the main project area of Cordova Bay on the southwest side of Prince of Wales Island, and in three areas on the east side of Prince of Wales Island in accordance with instructions for Project CS-377. Shoreline inspection for this season was confined mainly to the area covered by this season's hydrographic surveys. In the areas north of Shiprock Point, on the west side of Cordova Bay, and on the east side of Prince of Wales Island only very small amounts of shoreline inspection were done.

The Cordova Bay area is a large deep watered area with many inlets, arms, and bights that cut up the land areas. In the southern part, the Barrier Islands extend far out into the bay. The terrain in the Barrier Islands is very broken with numerous small islands and offshore rocks covering the area. A few small tidal lakes are found on several of the islands. Most of the islands are 100 to 200 feet in height. The land area in the rest of Cordova Bay is mostly rugged wooded mountains cut by deep valleys, bays and inlets.

The areas on the east side of Prince of Wales Island in which the instructions required control station identification were in or near long deep bays. These inlets have numerous small bays and arms that are in general very deep. The land areas are nearly all very mountainous with dense timber except near the summits of the highest peaks. The higher mountains inshore are very steep and rugged and are usually bare near the summits.

There are very few cultural features in the areas covered by field inspection. In the Cordova Bay area there were only three cultural features. A small trapper's cabin was found at the old Klinkwan village site. The landmark and remains of the village have been destroyed and should be deleted from the chart. An old cannery site on the north shore of Hunter Bay is visible but no structures remain. At the northern end of the area opposite Sukkwan Strait there is an abandoned mine. This was charted as Copper City, but there are no buildings still standing.

Only control station identification was done on the east side of Prince of Wales Island. No detailed inspection of cultural features was made in this area.

The single lens photographs obtained from the Geological Survey were very poor which made field inspection difficult. These prints were very hazy and had very little contrast.

The nine lens photos were clear and had very good contrast except in areas where the sun's reflection blurred them. Usually a better print could be found in these areas, but on several photographs along the west side of Cordova Bay some difficulties were encountered.

Densities and tones were not inspected on the land areas. In water areas shoals and kelp areas were easily visible on the nine lens photographs.

3. HORIZONTAL CONTROL

(a) No supplemental triangulation control was established in connection with the field inspection. Since photo compilation had not been made for the area, graphic control sheets were surveyed to control the hydrography. These

sheets should be very helpful in making the compilation. The short sections of shoreline in the vicinity of many of the stations will probably be helpful to the compiler.

Three new main scheme triangulation stations were established during the survey. These are BLACK 2, 1953; EGG 2, 1953; and DEWEY 2, 1953.

(b) All control is on N. A. 1927 datum and no datum adjustment are necessary.

(c) All control was established by the Coast and Geodetic Survey.

(d) No field inspection was done this season in the vicinity of Sukkwan Strait and South Pass. This section was deferred in expectation of receiving nine-lens photographs. Then near the close of the season, work on Project CS-357 was suspended to undertake the special wire drag survey at Hollis Anchorage. A better field inspection can be made when the remaining area is covered by nine-lens photographs. The single-lens photographs provided by the Geological Survey can be considered of very little value for field inspection in this area. *3 this section*

(e) In the Cordova Bay area the triangulation stations that were omitted in the photo identification were omitted in accordance with Paragraph 12 of Instructions dated 17 March 1953. For stations omitted in Sukkwan Strait and South Pass see Paragraph 3(d) of this report.

The stations on the east side of Prince of Wales Island that were omitted were in accordance with Paragraph 13 of Instructions dated 17 March 1953.

The following stations were reported as lost:

- | | |
|--------------------------|---------------|
| NEW, 1908 | FRONT, 1909 |
| GREEN, 1907 | DOPE, 1909 |
| N. W. CHURCH SPIRE, 1909 | BAD, 1909 |
| OUR, 1909 | LIME, 1905-18 |
| CAN, 1909 | HUB, 1907 |
| TOP, 1909 | |

Stations NEW, 1908 and GREEN, 1907 were the only two stations of the list that were photo identified. At NEW, 1908 the station mark was not found but the old blaze in tree and the rock pinnacle the station was on was found. The pinnacle is only about 4 feet in diameter which made positive identification possible. At GREEN, 1907 the old R. M. drill hole was found and identified. The station mark was not found.

For further information under this heading see Triangulation Reports, Ship HODGSON, 1953.

(f) The following horizontal control stations were identified:

STATION	PHOTO NO.	QUALITY OF IDENTIFICATION	REMARKS
<u>WEST OF PRINCE OF WALES</u>	<u>NINE LENS</u>		
ANCHOR, 1909	41015	Positive	Triangulation
ATA, 1918	41003	"	"
Axe	40991	"	Topo - 1953
BAN, 1925	40984	"	Triangulation
BARRIER, 1908	40992	"	"

STATION	PHOTO NO.	QUALITY OF IDENTIFICATION	REMARKS
BLACK 2, 1953	h0991	Positive	Triangulation
BOAT, 1909-25	h0985	"	"
CEDAR 2, 1908	h1018	"	"
CLBO, 1909	h1015	"	"
CLOPP, 1907	h0979	"	"
COB, 1925	h0984	"	"
COFFER 2, 1908	h1018	"	"
CREEK, 1909	h0993	"	"
Day	h0991	"	Topo - 1953
DENBY 2, 1953	h0986	"	Triangulation
EGG 2, 1953	h0986	"	"
FAR, 1909	h0991	"	"
FLAT 2, 1908	h1002	"	"
FOG, 1908	h1002	"	"
GRASS, 1908-14	h1002	"	"
GREEN, 1907	h0977	"	"
HAS, 1918	h1004	"	"
HEN, 1907	h0977	"	"
Hip	h1011	"	Topo - 1953
HUNTER, 1909	h1035	"	Triangulation
JACK, 1907	h0978	Doubtful	"
Jar	h0992	Positive	Topo - 1953
KEET, 1918	h1015	"	Triangulation
KLENNAN, 1909	h1035	"	"
LEDGE 2, 1908	h0988	"	"
LITTLE, 1909	h1033	"	"
MAB, 1918	h1005	"	"
MARBLE 2, 1925	h0983	"	"
MAD, 1918	h1015	"	"
MEX, 1909	h0990	"	"
HEW, 1908	h1000	"	"
NICE, 1907	h0977	"	"
NING, 1925	h0913	"	"
NUT, 1918	h1002	Doubtful	"
NET, 1909	h1015	Positive	"
Ram	h1036	"	Topo - 1953
RUEA, 1909	h1034	"	Triangulation
ROUGH 2, 1908	h0982	"	"
Rut	h1036	"	Topo - 1953
SHIP 2, 1908	h0997	"	Triangulation
SHOB, 1907	h0978	"	"
SOUTH ROCK, 1909-53	h0915	"	"
TITAN, 1909	h1033	"	"
Tomb	h0989	"	Topo - 1953
TRIM, 1925	h0979	"	Triangulation
TURN, 1909	h1012	"	"
UP, 1918	h1053	"	"
Vim	h0991	"	Topo - 1953
WEST, 1909	h0989	"	Triangulation
Yan	h0991	"	Topo - 1953
Zag	h0991	"	Topo - 1953
	Single Lens		
BRETT, 1908-14	SEA13-091	Doubtful	Triangulation
ROUND, 1908-14	SEA26-020	Positive	"

STATION	PHOTO NO.	QUALITY OF IDENTIFICATION	REMARKS
EAST OF PRINCE OF WALES ISLAND			
BAKE, 1907	SEA29-042	Positive	Triangulation
BAT, 1907	SEA22-119	"	"
BGB, 1924	X15,026	"	"
BLACK, 1912	SEA103-006	"	"
CHO., 1924	SEA22-025	"	"
DRICK, 1912	SEA22-004	"	"
END, 1912	SEA22-009	"	"
HALLIDAY, 1912	SEA103-006	"	"
HEAD, 1922	SEA22-005	"	"
INGRAHAM, 1912-21	SEA103-004	"	"
KEN, 1921	SEA22-005	"	"
KHOB, 1924	SEA29-044	"	"
MOLRA ROCK, 1912	SEA22-135	"	"
NEST, 1912	SEA22-134	"	"
OUT, 1911	X15-026	"	"
PIT, 1924	X15,030	"	"
SCOTT, 1912	SEA15-065	"	"
SCRUB, 1924	SEA29-042	"	"
SUN, 1912	SEA103-005	"	"
TAG, 1924	SEA103-022	"	"
TIP, 1924	SEA22-025	"	"

Of the stations listed doubtful identification was made on stations: JACK, 1907; NUT, 1907; and BRETT, 1908-1/4. Those stations are not required by the instructions since other stations in the immediate vicinity were used to meet the spacing requirements.

Station JACK, 1907 was marked doubtful because the glare of the sunlight on the photographs made positive identification difficult except to large objects.

Station NUT, 1907 was marked doubtful since overhanging trees and shadows eliminated all object that would have made good subpoints. The subpoint used was a bond in the high water mark that did not show clearly on the photograph.

Station BRETT, 1907 was identified on a single lens photograph furnished by the Geological Survey which was very dull and hazy. It was marked doubtful since the subpoints did not show clear or sharp on the photograph.

4. VERTICAL CONTROL

Not applicable.

5. CONTOURS AND DRAINAGE

Not applicable.

6. WOODLAND COVER

All land areas not covered by storm high waters were densely wooded with coniferous trees and underbrush except on very high mountains. A few offshore rocks to the south and west of the Barrier Islands were bare. A number of areas on the east side of Prince of Wales and a few areas in the Cordova Bay area had been logged out. These areas were easily seen on the nine lens photographs.

7. SHORELINES AND ALONGSHORE FEATURES

(a) Shoreline was inspected from a boat running as close inshore as was safe. The mean high water line shows clearly on the nine lens photos where shadows or overhanging trees do not obscure it. In most areas not opened to the sea the mean high water line is at the tree line. In some areas where the land protrudes up steeply from the shoreline the trees overhang it as much as 4 to 5 meters. In other areas, those open to the sea, it is usually visible on the photographs but may be as far as 50 meters from the tree line.

The mean high water line is indicated at random intervals on photographs or where it is not clear.

(b) The low water line is not indicated on the photographs, although, a number of areas were marked foul when it was considered too shoal to investigate with a motor whale boat. In some cases where a number of submerged rocks were grouped together the area would be marked foul out to the kelp line.

(c) The foreshore in the vicinity of the Barrier Islands was mostly very rocky with numerous rock ledges and reefs that cover at high water. There are also many small bights with boulder, rock or gravel beaches in this area. Just north of the Barrier Islands there are many bights and small bays which have some sand beaches formed by streams that run into them.

(d) There were a few bluffs and cliffs seen over the area. None of these were marked on the photographs. However, most of them are readily identifiable on the photographs due to the lack of vegetation. They should be obvious in a stereoscopic model.

(e) In the project area where shoreline inspection was done no shoreline structures were noted other than the permanent fish trap at the mouth of Housa Inlet. This structure was used by small fishing craft as a mooring. It was permanently secured to the beach, and had not been used as a trap for many years. It is indicated on the photograph.

8. OFFSHORE FEATURES

In the hydrographic survey area covered by field inspection important offshore features and possible dangers to navigation were indicated on the photographs. Many of the offshore rocks were located by hydrographic and/or topographic means.

In two places in the area inspected this season there were rocks that were indicated that did not show clearly on the photographs.

The first is a sunken rock in Eureka Channel about 1.1 mile NE of Far Point. In the vicinity of this rock there is a kelp area about 30 meters in diameter that appears to show on the photo. A hydrographic fix was taken on the rock and a check on its location can be obtained from the hydrographic sheet.

The second rock not clearly visible on the photographs was a rock awash about 200 meters SSE of triangulation station BIRD, 1909-53. This rock was not located by the hydrographic party, but it was noted on the photograph. It may show a little clearer on the office print. However, if a positive location cannot be made using the office prints, further hydrographic investigation is necessary.

Since the field inspection was done in conjunction with the hydrographic survey, some of the offshore features were omitted from the photographs if previously located by other methods. Although, an attempt was made to field inspect all offshore features whether they had been previously located or not.

Heights of rock were estimated in all cases. All rocks were visited, but in most cases a landing was not made. When the field inspection was made a pencil notation of the time, date, and estimated height was made on the photographs. At the close of the day heights of rocks were reduced to MLW and all notes were taken.

9. LANDMARKS AND AIDS

(a) The only landmark noted was an abandoned light on Turn Point. It is station Ram identified on photograph Number 41036. Since it is a recoverable topographic station no photo location is needed.

(b) No interior landmarks will be listed since no interior inspection was done.

(c) Inapplicable.

(d) The following fixed aids to navigation are indicated on the photographs:

AID	PHOTO NOS.	HYDROGRAPHIC NAME	REMARKS
TELEVAK STRAIT LIGHT	410978		
MELLEN ROCK LIGHT	411003		
MOUND POINT LIGHT	SEA29-0/41		
CENTER ISLAND DAYBEACON	410991	Zag	Topo signal
GUIDE ROCKS DAYBEACON	411033	Cab	" "
TURN ISLAND DAYBEACON	411012	TURN, 1909-53	Triang. Station
QUIETER BAY DAYBEACON	411036		
EUREKA CHANNEL DAYBEACON	410992	Jar	Topo signal

The four aids listed above that were not located should be located by photogrammetric methods. No identification cards were made for those. All four were pricked direct.

The other aids listed have been located but were identified to be used in the control of the radial plot. Guide Rocks Daybeacon was identified but no card was submitted since it is not needed for control of the plot.

(e) Inapplicable.

10. BOUNDRIES, MONUMENT, AND LINES

Inapplicable.

11. OTHER CONTROL

A number of topographic stations were identified on the photographs that were not listed as recoverable topographic stations. When these were identified no pricking cards were submitted.

The specified spacing for recoverable topographic stations was complied with in the area covered by the hydrographic survey. Listing covered under

side heading 3(C).

12. OTHER INTERIOR FEATURES

Covered under side heading 2.

13. GEOGRAPHIC NAMES

Geographic names will be covered in a separate report.

Only charted names were used in connection with records and reports.

14. SPECIAL REPORTS AND SUPPLEMENTAL DATA

Supplemental data includes other phases of field work - triangulation data, topographic data, hydrographic data and coast pilot notes.

Photogrammetric data forwarded separately:

Field photographs

Control Station Identification Cards

Data to be forwarded:

Descriptive Reports for Hydrographic Sheets:

HO-1153 HO-1353
HO-1253 HO-2153

Triangulation Report - Cordova Bay - 1953

Descriptions of Triangulation Stations

Descriptions of Recoverable Topographic Stations

Recovery Notes, Triangulation Stations

Report on Landmarks and Fixed Aids

Geographic Names Report - L. HECK 857

Coast Pilot Notes

Respectfully submitted,

Donald L. Campbell
Donald L. Campbell,
Ens., USC&GS

Approved and forwarded:

F. R. Gossett

F. R. Gossett,
CDR, USC&GS
Comdg., Ship HODGSON

(c) A few of the areas marked foul on the manuscripts and shown by a light color tone on the photos were not found to exist in the field. Large schools of thousands of jelly fish which gave the appearance of shoals (light color tone in water) were observed during the season. It is believed that these fish produced the light color tone on the photos where the area was marked foul and a shoal was not found.

(d) The shoreline of Jackson Island (dashed as approximate) was found to be out in location. This was probably due to the poor photo (Navy Sea Prints) coverage and will be corrected when the 1954 photos are plotted.

The areas where these discrepancies were encountered are noted on the field photographs.

Respectfully submitted,

Robert C. Munson
Robert C. Munson,
Ensign, USC&GS

Approved by:

John Bowie
John Bowie,
CDF, USC&GS
Comdg., Ship HODGSON

-15-

FIELD INSPECTION REPORT

FOR

HUNTER BAY, RUTH BAY, KLAKAS INLET, KASSA INLET THRU HASSIAH
INLET AND VICINITY OF JACKSON ISLAND.

CORDOVA BAY - S. E. ALASKA

1954 FIELD SEASON

PH-117 CS-357

2. AREAL FIELD INSPECTION

The area covered in this report is located on the southwest side of Prince of Wales Island from Hunter Bay thru Hassiah Inlet on the east side of Cordova Bay and the vicinity of Jackson Island on the west side of Cordova Bay.

There are no salient cultural features. The only natural feature is the land area is densely covered with coniferous trees.

This field inspection is believed to be standard.

The area from Hunter Bay through Hassiah Inlet is covered adequately with nine-lens (scale 1/10,000) photographs. The good quality of the photos enabled an adequate field inspection in all of this area with the exception of the west shore of Klakas Inlet which is covered with heavy shadows. The quality of the Navy SEA Prints (scale ratio 1/10,000) covering the vicinity of Jackson Island is very poor. This poor quality made it difficult for field inspection and for recovery of office photo prints used to locate the photo-hydro signals.

Densities and tones were not inspected on the land area. In the water area, shoals and kelp area are easily discernable.

3, 4, 5. Inapplicable

6. WOODLAND COVER

All land area not covered by storm high water is densely wooded with coniferous trees with the exception of the small logged-off areas and the few bare mountain peaks.

7. SHORELINE AND ALONGSHORE FEATURES

(a) The shoreline was inspected from the beach at the photo-hydro signal locations. All other areas were inspected from a boat. The mean high water line is delineated on the field photos. In the areas where the gradient of the beach is steep, the MHWL corresponds closely with the treeline. Elsewhere it is distinguished on the photos by a black band (water action on the rock and dried kelp) along the beach.

(b) The low water line is dotted on the field photographs as it was observed at times of low tide. The low water line corresponds to the offshore edge of the light color tone along the water line on the photos.

(c) The foreshore is rock and boulders with a few areas of sand and gravel at the stream mouths and at the head of the small bights.

(d) The only prominent structures along the shoreline are the fish traps moorings. These moorings are located as follows:

1. East end of Hunter Bay
2. Destroyed cannery site in Hunter Bay
3. Ciam Cove in Kassa Inlet

8. OFFSHORE FEATURES

All apparent offshore features were visited and where it was possible a landing was made. All of the rocks and shoals are defined on the field photos and the heights and depths, times and dates pertaining to each feature are noted. All heights are estimated and all depths are measured.

All of the rocks noted during field inspection and hydrography are visible on the photos although some of them were not located on the preliminary manuscript. These rocks and their heights are shown on the field photos.

9. LANDMARKS AND AIDS

There are two fixed aids to navigation: (1) the Beacon on the rock in the middle of Hunter Bay. (2) Mellen Rock Light.

10. Inapplicable

11. OTHER CONTROL

The following is the list of photo-hydro signals and the method used for their location. The information necessary for the location of the signals is on the back of the field photos as listed. All recoverable marked photo-topo signals are denoted by the year (1954) after their name.

12. Inapplicable

13. Geographic Names

Geographic names will be covered in each corresponding Hydrographic Survey Descriptive Report.

14. Special Reports and Supplemental Data

Forwarded to the Director:

11 June 1954 via Railway Express
Office Photos
Field Photos

14 June 1954 via Registered Mail
Blackline Manuscripts
Field Inspection Reports (TAH BAY, HESSA INLET)

3 September 1954 via Railway Express
Office Photos
Field Photos

3 September 1954 via Registered Air Mail
Blackline Manuscripts
Film Positive

18 October 1954 via Railway Express
Office Photos
Field Photos

19 October 1954 via Registered Mail
Blackline Manuscripts
Blueline Impressions

Tide Records (Registered Mail)
28 May 1954 (HUNTER BAY)
14 June 1954 (MAX COVE)
30 July 1954 (KASSA INLET)
3 Sept. 1954 (MABEL BAY, KASSA INLET, HUNTER BAY)

To be forwarded at later date:
Hydrographic Survey Sheets HO-1354 thru HO-1754
Hydrographic Survey Descriptive Reports for same
Sounding Records & Fathograms

15. Remarks on Preliminary Shoreline Manuscript

The preliminary manuscripts were found to be very good. The following are the discrepancies found:

(a) The shoreline is too high in some areas.

(b) Some of the small offshore rocks which appeared on the photos were not located on the manuscripts.

HASSIAH INLET TO TRIANG. STA. HAS, 1918

<u>HYDRO SIGNALS</u>	<u>MANU-SCRIPT</u>	<u>PHOTO NO.</u>	<u>METHOD OF LOCATION</u>
Abo	T-1129	41006	Angle and dist. from off. p.p.
All	"	41006	Angle and dist. from off. p.p.
Bar	"	41006	Angle and dist. from off. p.p.
Box	"	41006	Angle and dist. from off. p.p.
Cal	"	41006	Angle and dist. from off. p.p.
Dim	"	41000	Angle and dist. from off. p.p.
Fig	"	41006	Angle and dist. from off. p.p.
Fry, 1954	"	41006	Angle and dist. from off. p.p.
Hid	"	41006	Direct transfer
Ivy	"	41004	Radial plot
Key	"	41004	Angle and dist. from off. p.p.
Liz	"	41006	Angle and dist. from off. p.p.
Man	"4	41006	Angle and dist. from off. p.p.
Nor	"	41006	Angle and dist. from off. p.p.
Pet	"	41006	Angle and dist. from off. p.p.
Rim	"	41006	Angle and dist. from off. p.p.
Say	"	41006	Angle and dist. from off. p.p.

KIAKAS INLET

HYDRO SIGNAL	MANUSCRIPT	PHOTO NO.	METHOD OF LOCATION
Air	T-11300	41036	Angle and dist. from off. p.p.
Alp	T-11300	41036	Angle and dist. from off. p.p.
Ape	T-11295	41059	Field radial plot
Awe	T-11300	41036	Angle and dist. from off. p.p.
Eng (Upper Klakas)	T-11300	41037	Range and angle to off. p.p.
Beg (Lower Klakas)	T-11300	41036	Angle and dist. from off. p.p.
Bus, 1954 (marked)	T-11300	41036	Angle and dist. from off. p.p.
But	T-11295	41059	Field radial plot
Can, 1954 (marked)	T-11300	41037	Angle and dist. from off. p.p.
Cop	T-11300	41036	Angle and dist. from off. p.p.
Dan	T-11300	41036	Angle and dist. from off. p.p.
Did	T-11300	41036	Angle and dist. from off. p.p.
Eat	T-11298	41040	Office p.p.
Eva	T-11300	41037	Office p.p.
Fag	T-11298	41040	Angle and dist. from off. p.p.
Few	T-11300	41036	Angle and dist. from off. p.p.
Fox	T-11298	41037	Field radial plot
Gun	T-11300	41036	Angle and dist. from off. p.p.
How	T-11298	41040	Angle and dist. from off. p.p.
Ice	T-11300	41036	Angle and dist. from off. p.p.
Ink, 1954 (marked)	T-11298	41040	Angle and dist. from off. p.p.
Jug	T-11298	41040	Angle and dist. from off. p.p.
Ked	T-11300	41036	Angle and dist. from off. p.p.
Keg	T-11298	41040	Field radial plot
Kin	T-11300	41036	Office p.p.
Let	T-11298	41037	Angle and dist. from off. p.p.
Nob	T-11298	41037	Office p.p.
Not	T-11300	41036	Angle and dist. from off. p.p.
Num	T-11300	41036	Angle and dist. from off. p.p.
Ott	T-11298	41037	Range and dist. to office p.p.
Pat	T-11298	41037	Angle and dist. from off. p.p.
Red	T-11300	41036	Office p.p.
Sam, 1954 (marked)	T-11295	41059	Angle and dist. from off. p.p.
Sis	T-11300	41036	Angle and dist. from off. p.p.
Tax	T-11300	41036	Angle and dist. from off. p.p.
Up	T-11298	41037	Field radial plot
Vat	T-11300	41036	Angle and dist. from off. p.p.
Via	T-11300	41036	Office p.p.
Vim	T-11298	41037	Office p.p.
Way	T-11300	41036	Pricked direct, field radial plot
Yer	T-11300	41036	Angle and dist. from off. p.p.
Zag, 1953	T-11300	41036	Office p.p.
Zoo	T-11298	41037	Field radial plot

Shoreline Photo No.	Manuscript
41035	T-11295
41036	T-11298
41037	T-11300
41038	
41039	

JACKSON ISLAND TO TRIANG. STA. GRASS

HYDRO SIGNAL	MANU- SCRIPT	PHOTO NO.	METHOD OF LOCATION
Bob	T-11296	40927	Angle and dist. from off. p.p.
Cow	T-11293	117-139	Angle and dist. from off. p.p.
Day	T-11293	117-141	Angle and dist. from off. p.p.
Eve	T-11293	117-141	Direct transfer
Fid	T-11293	41003	Angle and dist. from off. p.p.
Gal	T-11293	117-140	Angle and dist. from off. p.p.
His	T-11296	40927	Angle and dist. from off. p.p.
Joe	T-11293	117-141	Direct transfer
Log	T-11293	41003	Angle and dist. from off. p.p.
Ram	T-11296	40927	Angle and dist. from off. p.p.
Rip	T-11296	117-109	Angle and dist. from off. p.p.
Sun	T-11293	117-140	Off. p.p.
Tick, 1954	T-11293	117-140	Angle and dist. from off. p.p.
Vet	T-11293	117-140	Angle and dist. from off. p.p.

MABEL HAY

HYDRO SIGNALS	MANU-SCRIPT	PHOTO NO.	
Age	T-11297	40999	Angle and dist. from off. p.p.
Ant	"	40999	Off. p.p.
Bad	"	41000	Angle and dist. from off. p.p.
Bat	"	40999	Angle and dist. from off. p.p.
Can	"	40999	Angle and dist. from off. p.p.
Did	"	40999	Angle and dist. from off. p.p.
Doc	"	40999	Off. p.p.
Eol	"	40999	Angle and dist. from off. p.p.
Era	"	41000	Angle and dist. from off. p.p.
Eye	"	40999	Angle and dist. from off. p.p.
Fee	"	40999	Angle and dist. from off. p.p.
Get	"	40999	Angle and dist. from off. p.p.
Kid	"	40999	Angle and dist. from field sub. pt.
Lap	"	40999	Off. p.p.
Lie	"	40999	Angle and dist. from off. p.p.
Odd	"	40999	Angle and dist. from off. p.p.
Out	"	40999	Angle and dist. from off. p.p.
Pit	"	40999	Off. p.p.
Run	"	40999	Angle and dist. from off. p.p.
Sis	"	40999	Angle and dist. from off. p.p.
Sit	"	40999	Angle and dist. from off. p.p.
Tag	"	41000	Angle and dist. from off. p.p.
Tim	"	40999	Off. p.p.
Wet	"	40999	Angle and dist. from off. p.p.
Vim	"	40999	Angle and dist. from off. p.p.

SHIP ISLAND PASSAGE TO MABEL BAY

HYDRO SIGNAL	MANU- SCRIPT	PHOTO NO.	METHOD OF LOCATION
Act	T-11297	40999	Angle and dist. from off. p.p.
Caf	"	40999	Angle and dist. from off. p.p.
Cat	"	40999	Off. p.p.
Eva	"	40999	Angle and dist. from off. p.p.
Far	"	40999	Angle and dist. from off. p.p.
Gip	"	40999	Field radial plot
Gun	"	41000	Angle and dist. from field sub. pt.
Hat	"	40999	Angle and dist. from off. p.p.
Imp	"	40999	Angle and dist. from off. p.p.
Jet	"	40999	Angle and dist. from off. p.p.
Job	"	40999	Angle and dist. from off. p.p.
Kit	"	40999	Field radial plot
Log	"	40999	Angle and dist. from off. p.p.
Mit	"	40999	Angle and dist. from off. p.p.
Mop	" ₄	41000	Angle and dist. from off. p.p.
Nut	"	40999	Angle and dist. from off. p.p.
Pal	"	41000	Angle and dist. from off. p.p.
Pan	"	40999	Angle and dist. from off. p.p.
Quo	"	41000	Angle and dist. from off. p.p.
Ram	"	40999	Off. p.p.
R&d	"	40999	Off. p.p.
Rik	"	40999	Angle and dist. from off. p.p.
Sin	"	40999	Field radial plot
Try	"	40999	Angle and dist. from off. p.p.
Veg	"	40999	Angle and dist. from off. p.p.

HYDRO SIGNAL	MANU- SCRIPT	PHOTO NO.	METHOD OF LOCATION
Pic	T-11297	41009	Angle and dist. from off. p.p.
Pig	T-11298	41009	Angle and dist. from field sub pt.
Pun	T-11297	41009	Angle and dist. from off. p.p.
Quo	T-11298	41042	do
Rat	T-11298	41009	do
Rec	T-11298	41042 ¹	Direct transfer
Rot	T-11297	41009	Angle and dist. from off. p.p.
Ros	T-11297	41009	do
Sam	T-11299	41009	Off. p.p.
Sow, 1954 (marked)	T-11298	41042	Off. p.p.
Sue	T-11297	41009	Angle and dist. from off. p.p.
Tad	T-11299	41009	do
Tim	T-11299	40996	do
Tin	T-11297	41009	do
Tom	T-11298	41042	Off. p.p.
Unc	T-11298	41042	Angle and dist. from off. p.p.
Up	T-11297	41009	Off. p.p.
Vix	T-11297	41009	Angle and dist. from off. p.p.
Why	T-11297	41009	do
Wil	T-11297	41009	do
Yak	T-11299	41009	do
You	T-11299	41009	do
Zek	T-11297	41009	do
Zip	T-11299	40996	do
Zoo	T-11299	41009	do

Shoreline
 Photo No.
 41042 & 41010
 40996
 40997
 41043
 41007

KASSA INLET & SHIP ISLAND PASSAGE TO TRIANG. STA. LEDGE

-25-

HYDRO SIGNAL	MANU- SCRIPT	PHOTO NO.	METHOD OF LOCATION
Ant	T-11295	h1042	Angle and dist. from off. p.p.
Art	T-11298	h1042	do
Axe	T-11299	h0996	do
Bat	T-11297	h1009	do
Big	T-11299	h0996	Angle and dist. from field sub pt.
Bob	T-11297	h1042	Angle and dist. from off. p.p.
Box, 1953	T-11299	h0996	do
Boy	T-11297	h1009	do
Bug, 1954 (marked)	T-11299	h1009	do
Buz	T-11297	h1009	do
Cat	T-11299	h1009	do
Car	T-11297	h1009	do
Cy	T-11298	h1042	do
Don	T-11299	h1009	do
Dad	T-11299	h0996	do
Dog	T-11299	h1009	do
Don	T-11297	h1042	do
Dud	T-11299	h0996	do
Ed	T-11297	h1042	do
Elm	T-11297	h1009	do
Erg	T-11299	h0996	do
Fat	T-11297	h1042	do
Fir	T-11295	h1042	Direct transfer
Fog	T-11299	h1009	Angle and dist. from off. p.p.
Fox	T-11299	h0996	do
Gun	T-11299	h0996	do
Gus	T-11300	h1009	do
Han	T-11298	h1042	do
Hap	T-11297	h1042	do
Hik	T-11300	h1009	Angle and dist. from direct transfer sub pt.
Hill	T-11298	h1042	Direct transfer
Ill	T-11298	h1009	Angle and dist. from off. p.p.
Jab	T-11297	h1009	do
Jag	T-11298	h1009	Angle and dist. from direct transfer sub pt.
Job	T-11299	h1009	Angle and dist. from off. p.p.
Jon	T-11298	h1042	do
Ken	T-11298	h1042	do
Kid	T-11297	h1009	do
Lab	T-11299	h1009	do
Lad	T-11299	h0996	do
Let	T-11299	h0996	do
Lip	T-11299	h0996	Field radial plot
Lil	T-11297	h1009	Angle and dist. from off. p.p.
Liz	T-11297	h0996	Direct transfer
Loy	T-11298	h1042	Off. p.p.
Mad	T-11298	h1009	Off. p.p.
Mag	T-11299	h0996	Angle and dist. from off. p.p.
Mik	T-11297	h1009	do
Nam	T-11297	h1009	do
Nip	T-11298	h1009	do
Nod	T-11295	h1042	Off. p.p.
Oak	T-11297	h1009	Angle and dist. from off. p.p.
Ole	T-11297	h1009	do
Ox, 1954 (marked)	T-11298	h1009	Angle and dist. from field sub pt.

MAX COVE

HYDRO SIGNAL	MANU-SCRIPT	PHOTO NO.	METHOD OF LOCATION
Bat (Bat)	T-11300	41063	Angle and dist. from off. p.p.
Big	T-11300	41063	Angle and dist. from field radial plotted p.p.
Bob	T-11298	41063	Angle and dist. from off. p.p.
Cap	T-11300	41063	Office p.p.
Cow	T-11300	41063	Angle and dist. from off. p.p.
Dog	T-11300	41063	Angle and dist. from off. p.p.
End	T-11300	41063	Angle and dist. from off. p.p.
Gal	T-11300	41063	Angle and dist. from off. p.p.
Hit	T-11300	41063	Angle and dist. from field radial plotted p.p.
Joe	T-11300	41063	Angle and dist. from field radial plotted p.p.
Loy	T-11300	41063	Angle and dist. from field radial plotted p.p.
No. 1, 1954 (marked)	T-11298	41037	Angle and dist. from field radial plotted p.p.
Nut	T-11300	41063	Field radial plot
Ray	T-11300	41063	Angle and dist. from off. p.p.
Rob	T-11300	41063	Off. p.p.
Rut	T-11298	41037	Angle and dist. from off. p.p.
Tom	T-11300	41063	Angle and dist. from field radial plotted p.p.
Will	T-11300	41063	Field radial plot

Shoreline
 Photo No. Manuscript
 41037 T-11298
 41062 T-11300

RUTH BAY

HYDRO SIGNAL	MANU- SCRIPT	PHOTO NO.	METHOD OF LOCATION
Axe	T-11300	41012	Angle and dist. from off. p.p.
Ban	"	"	Office. p.p.
Day	"	"	Office p.p.
Doc	"	"	Angle and dist. from off. p.p.
Est	"	"	Angle and dist. from off. p.p.
Fat	"	"	Angle and dist. from off. p.p.
Fed	"	"	Angle and dist. from off. p.p.
Gal	"	"	Field radial plot
Gut	"	"	Field radial plot
Lot	"	"	Angle and dist. from off. p.p.
Ned	"	"	Angle and dist. from off. p.p.
Sag	"	"	Angle and dist. from off. p.p.
Six	"	"	Angle and dist. from off. p.p.
Sum	"	"	Field radial plot
Uno	"	"	Field radial plot
Zig	"	"	Angle and dist. from off. p.p.

Shoreline
Photo No.
41012

Manuscript
T-11300

HUNTER BAY

HYDRO SIGNAL	MANUSCRIPT	PHOTO NO.	METHOD OF LOCATION
All	T-11301	41065	Angle and dist. from off. p.p.
Apr	T-11300	41035	Office p.p.
Bee	T-11302	41035	Office p.p.
Bug	T-11300	41035	Angle and dist. from off. p.p.
Can	T-11303	41065	Angle and dist. from off. p.p.
Cow	T-11300	41035	Angle and dist. from off. p.p.
Cut	T-11301	41065	Angle and dist. from off. p.p.
Dog	T-11300	41035	Angle and dist. from field radial plotted p.p.
Dol	T-11303	41035	Field radial plot
Eek	T-11300	41035	Angle and dist. from off. p.p.
Elk	T-11300	41035	Range and dist. from off. p.p.
Fox	T-11300	41035	Angle and dist. from off. p.p.
Gus	T-11300	41035	Angle and dist. from off. p.p.
Hit	T-11301	41065	Angle and dist. from off. p.p.
Ill	T-11301	41065	Angle and dist. from off. p.p.
Jap	T-11301	41065	Office p.p.
Leg	T-11302	41035	Field radial plot
Log	T-11302	41035	Angle and dist. from off. p.p.
Mat	T-11300	41035	Angle and dist. from off. p.p.
Nan	T-11301	41065	Office p.p.
New	T-11302	41035	Range and dist. from off. p.p.
Nut	T-11300	41035	Angle and dist. from off. p.p.
Old	T-11301	41065	Angle and dist. from off. p.p.
Ox	T-11300	41035	Office p.p.
Pet	T-11303	41035	Angle and dist. from off. p.p.
Pig	T-11300	41035	Office p.p.
Rat	T-11300	41035	Range and dist. from off. p.p.
Sam	T-11301	41065	Angle and dist. from off. p.p.
Sky	T-11303	41065	Field radial plot
Sow	T-11300	41035	Field radial plot
Sup	T-11303	41035	Office p.p.
Tex	T-11301	41065	Angle and dist. from off. p.p.
Tim	T-11300	41035	Angle and dist. from off. p.p.
Tom	T-11300	41035	Angle and dist. from off. p.p.
Vix	T-11300	41035	Angle and dist. from off. p.p.
Yel	T-11303	41035	Angle and dist. from off. p.p.
ZIP	T-11300	41035	Angle and dist. from off. p.p.
Zoo	T-11300	41035	Angle and dist. from off. p.p.

Shoreline

Photo No.	Manuscript
41035	T-11300
41065	T-11301
	T-11302
	T-11303

PHOTOGRAMMETRIC PLOT REPORT

PROJECT NO. Ph-117

Surveys Nos. T-9435, T-9903, T-11035 & T-11293 thru T-11298

21. AREA COVERED

This radial plot report covers the entire area of Surveys Nos. T-9435, T-9903, T-11293, T-11294, T-11295, T-11297 and T-11298, that portion of Survey No. T-11296 that lies north of Tlevak Strait, the southwestern corner of T-11035. These are all shoreline surveys located along Cordova Bay, the north side of Tlevak Strait, Hetta Inlet and Nutkwa Inlet and extends northward from Kassa Inlet to the entrance to Sukkawn Inlet. That part of Klakas Inlet covered by photography was also included.

22. METHOD - RADIAL PLOT

Map Manuscripts:

Vinylite sheets with polyconic projections in black and Universal Mercator, Alaska, Zone 8, grids in red, at a scale of 1:10,000 were furnished by the Washington office. Base sheets were prepared in this office.

The positions of all control and substitute stations were plotted using the beam compass and meter bar.

A sketch showing the layout of the surveys and the distribution of control and photograph centers is attached to this report. A list of control is also attached to this report.

Photographs:

Unmounted photographs taken 8 July 1953, with the U.S.C. & G. S. nine-lens camera, focal length 8 1/4 inches, at a scale of 1:10,000 and unmounted single lens photographs taken during 1948 at a scale of 1:40,000 and ratioed to a scale of 1:10,000 were used in this plot.

Thirty-seven nine-lens and fifteen single lens photographs were used in this plot. They are numbered as follows:

Nine-lens photographs

- 40954 thru 40958
- 40977 thru 40979
- 40998 thru 41007
- 41009
- 41038 thru 41040
- 41042 thru 41051
- 41053
- 41055 and 41056
- 41058 thru 41062

Single lens photographs

- SEA 26-018 thru SEA 26-022
- SEA 117-108 thru SEA 117-111
- SEA 117-139 thru SEA 117-144

Standard symbols were used on the photographs.

-18-

22. METHOD - RADIAL PLOT (cont'd)

Templets:

Vinylite templets were made for all photographs. The master templet was used to make adjustments for film and paper distortion and chamber displacements on the nine-lens photographs. No adjustments for film or paper distortion could be made on the templets for the single lens photographs because there were no fiducial marks.

Closure and Adjustment of Control:

Vinylite base sheets were prepared in this office. Since junctions of grid lines between several of the manuscripts could not be made, the base sheets were prepared by transferring several projection intersections, including all manuscript corners, along the neat limits of the manuscripts to the base sheet. The projection intersections for Surveys T-11299, T-11300 and T-11301 as established by the first radial plot for this project were used as a base to continue northward to the limits of the project.

All control was transferred to the base sheets at the same time that the projection intersections were being transferred.

All pass points and photograph centers established, on Surveys Nos. T-11299, 11300 and 11301, by the first plot were transferred to the base sheets for this plot.

The radial plot, actually a continuation of the first plot, was then constructed on the base sheets.

The templets for those photographs which are within the limits of surveys Nos. T-11299, T-11300 and T-11301 were relaid. Templets for 40998 to 41001 were laid next and it was found that control station NEW R.M. 1, 1908 could not be held with the other control. Templets for 41003 to 41009 were laid and control stations NEW R.M. 1, 1908 and NUT, 1918 could not be held. Templets for photographs 41044 to 41048 were then laid and again control station NUT, 1918 could not be held, however, a tie-in was made with station CEDAR 2, 1908. Templets for 41049 to 41056 were laid. Control station GULL, 1918 which had been identified in this office could not be held, however, a tie-in was made with station COPPER 2, 1908. All other templets for photographs on the east side of Cordova Bay were then adjusted in place. That part of the plot east of Cordova Bay was then complete except for the flight of single lens photographs numbered 26-018 to 26-022 which were then laid with the result that control stations FOG, 1908 and FLAT 2, 1908 could not be held.

Templets for photographs 40977 to 40979 and 40954 to 40956 were used. All control was held on these templets except SHOE, 1907-25. Then the templets for the remaining nine-lens and single lens photographs were laid and readjusted several times until the best possible result was obtained.

~~14~~

22. METHOD - RADIAL PLOT (cont'd)

Transfer of Points:

The positions of all photograph centers and pass points were transferred to the manuscripts by superimposing the manuscripts on the templets and matching common projection intersections and control points.

23. ADEQUACY OF CONTROL

293 The positions of photograph centers and pass points in Survey T-11193 may be weak due to extension of the plot beyond control and due to the poor quality of single lens photography.

In surveys T-11295 and T-11298, the two easternmost flights had no control, requiring a long bridge between the control stations at Hunter Bay (southern edge of T-11300) and control in Keete Inlet (northwest corner of T-11295). Positions of pass points in Klakās Inlet and at the head of Kassa Inlet may be quite weak due to this long bridge of 10 nine-lens photographs between control stations.

As previously stated several control stations could not be held in the radial plot.

Sub Pt. SHOE, 1907 - 25: Radially plotted position of the sub point falls 0.9 mm southeast of its computed position. Believed to be incorrectly identified by the field party. There is another "white spot" approximately 0.9 mm northeast of the "white spot" identified as the Sub Pt.

Sub Pt. NEW R.M. 1, 1908 - The radially plotted position of the Sub Pt. falls 1.5 mm north of its computed position. This may be due to either an error in computation of the position of the Sub Pt. or in the identification. First it was necessary to compute the position of NEW R.M. 1. The only information available was a bearing and distance from R.M. 1 to NEW, 1908. This bearing was assumed to be the magnetic bearing at the time the station was established.

Sub Pt. NUT, 1918 - The radially plotted position of the Sub. Pt. falls 2.4 mm WSW of its computed position. This may be due to incorrect identification as there is another point of ledge approximately in correct location that is visible on the photographs.

GULL, 1918 - The radially plotted position of this station falls 0.6 mm southeast of its geographic position. Probably due to misidentification in the compilation office. This station was not identified in the field.

FLAT 2, 1908 - No definite intersection obtained due to inability to identify accurately on the single lens photographs. A shadow point was identified on a photograph taken during 1953.

FOG, 1908 - The same conditions apply for this station as for FLAT 2, 1908.

24. SUPPLEMENTAL DATA

No graphic control surveys were used in this plot.

25. PHOTOGRAPHY

All nine-lens photographs have large light struck areas on the western side. Many have deep shadows, trees and relief displacement obscuring the shore line.

All of the single lens photographs have very poor definition and were taken five years prior to the nine-lens photographs making it almost impossible to find the points, that are common to both types of photographs.

No tilt determinations were made.

The definition is good on the nine-lens photographs except in the deep shadow and light struck areas.


The definition is very poor on the single lens photographs.

Respectfully Submitted
19 February 1954

Harry R. Rudolph
Harry R. Rudolph
Carto. Aid (Photo)

LIST OF CONTROL

No.	Name of Station	Identification
1	CLUMP, 1907-25	Sub Pt.
2	NEW R.M. 1, 1908	Sub Pt.
3	MAB, 1918	Sub Pt.
4	HAS, 1918	Sub Pt.
5	ATA, 1918	Sub Pt.
6	LIT, 1918	None
7	KEET, 1918	Direct
8	END, 1918	None
9	MED, 1918	Sub Pt.
10	COS, 1918	None
11	GULL, 1918	Ident. in Office
12	TREE, 1918	None
13	UP, 1918	Direct
14	IN, 1918	None
15	BOY, 1918	None
16	NUT, 1918	Sub Pt.
17	FLAG, 1908	None
18	CEDAR 2, 1908	Sub Pt.
19	COPPER 2, 1908	Sub Pt.
20	ROUND, 1908-14	Sub Pt.
21	EASY 2, 1908	None
22	FLAT 2, 1908	Sub Pt.
23	FOG, 1908	Sub Pt.
24	GRASS, 1905-18	Sub Pt.
25	FOOD, 1918	None
25	MELLOW ROCK, 1908	None
26	GREEN R.M. 1907-18	Sub Pt.
27	JACK, 1907	Sub Pt.
28	HEN, 1907	Sub Pt.
29	SHOE, 1907-25	Sub Pt.
30	NICE, 1907	Sub Pt.
31	LUCK, 1907	None

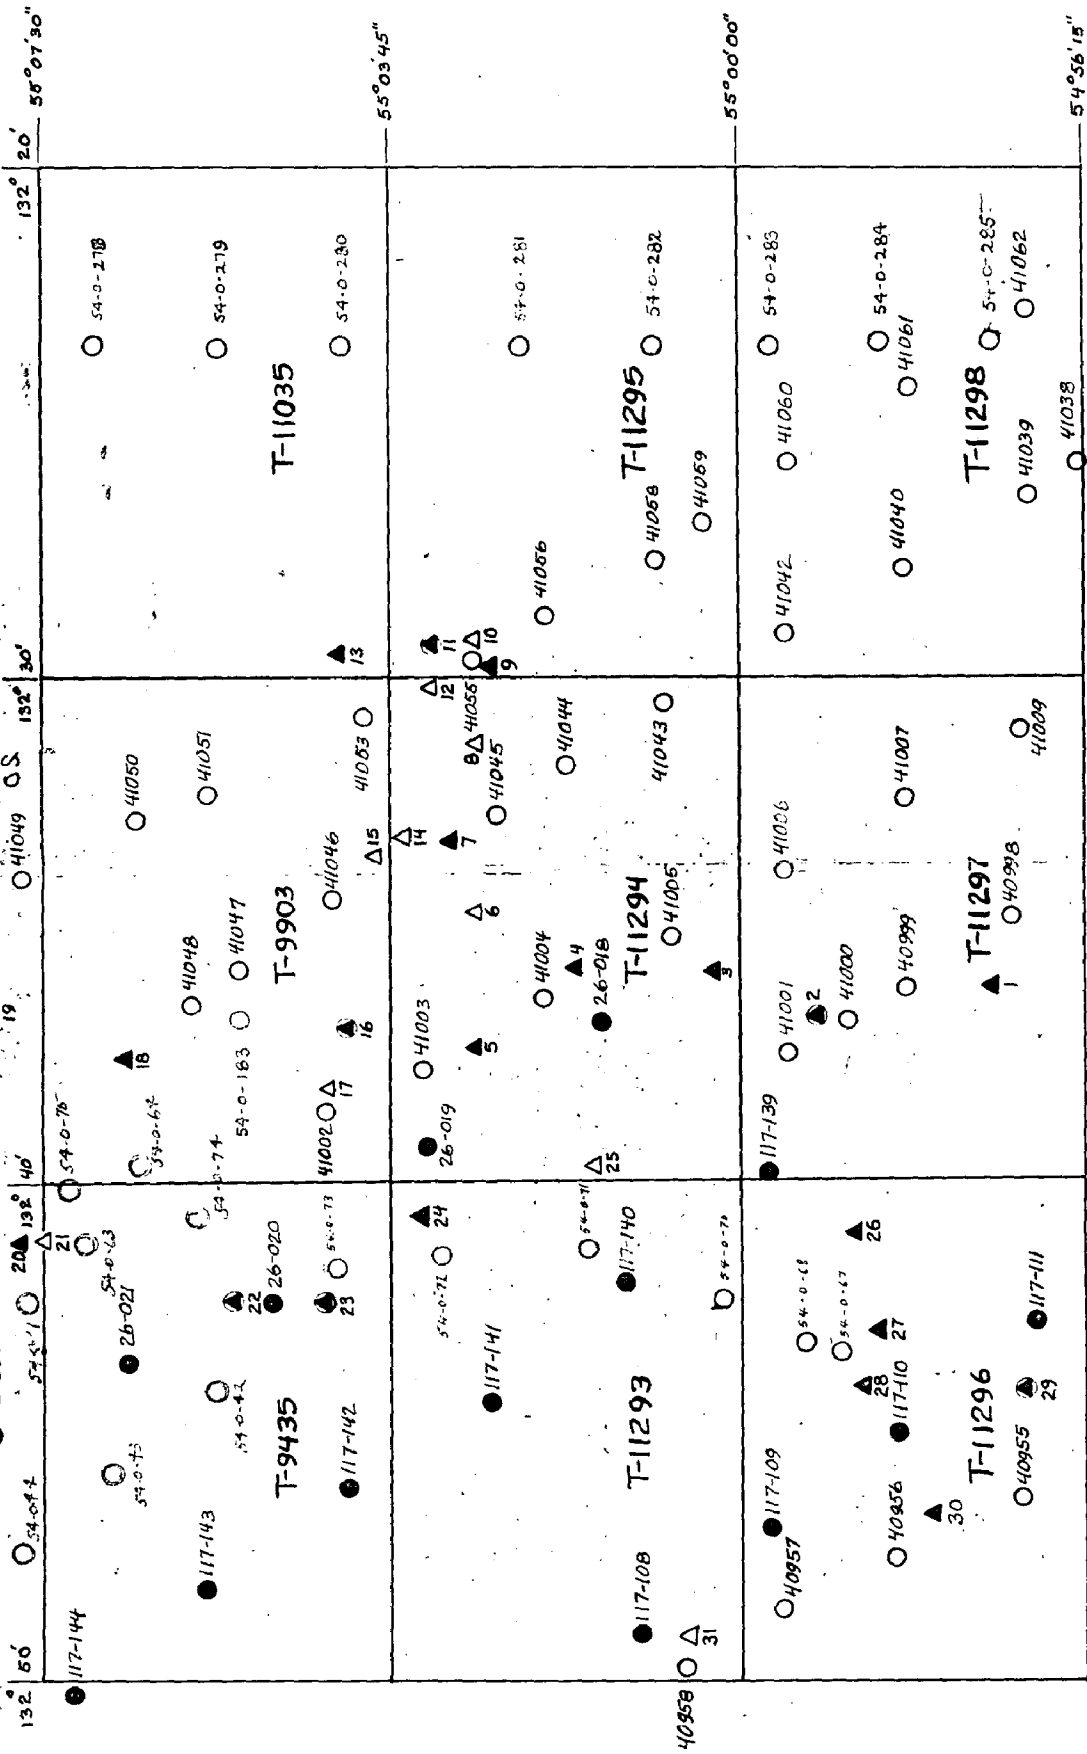

LAYOUT SKETCH
 PH-117
 SURVEYS NOS T-9435, T-9903, T-11035 and
 T-11293 to T-11298 inclusive
 ○ NINE LENS PHOTOGRAPHS
 ● SINGLE LENS PHOTOGRAPHS
 ▲ CONTROL STATIONS (identified)
 ○ CONTROL STATIONS (not held in plot)
 ▲ CONTROL STATIONS (not identified)
 ○ 1954 SINGLE LENS PHOTOGRAPHS

- 2 -

SUPPLEMENTARY RADIAL PLOT REPORT
Project Ph-117
Surveys T-9435, T-11293
& T-11296

A small plot was laid using fourteen (14) single lens ratioed photographs flown in June 1954. This was done so that the shoreline, which could only be approximately delineated in March 1954 because of inadequate photography, could be redelineated.

The photographs used in this plot are numbered as follows:
54-0-62 thru 64, 61, 63, 64, 67, 68, and 70 thru 75.

These photographs are superior in every respect to those used in the original plot. Photograph 54-0-69 was excessively tilted and was not included in this plot. 54-0-62 was omitted because it is almost a duplicate of 54-0-63.

The following control was held in the plot: Sub. Pt. NICE, 1907; Sub. Pt. JACK, 1907; Sub. Pt. HEN, 1907; Sub. Pt. GREEN, 1907 - 18; MELLEN ROCK LIGHT, 1954; Sub. Pt. GRASS, 1905 - 18; Sub. Pt. FLAT, 1907; Sub. Pt. ROUND, 1908 - 14, and Sub. Pt. BRETT, 1908.

Sub. Pt. FOG, 1908, which would not hold in the plot as identified by the field man, was rechecked in the office so that it agreed with the sketch as shown on Form M-2226-12. It was then held in the plot.

The plot is satisfactory. The area immediately around the center of photograph 54-0-70 is the weakest in the plot, because only slim intersections could be made for the location of the pass points. If photograph 54-0-69 could have been used in the plot, this relatively small area would have been entirely satisfactory.

The positions of the 1954 photographs have been added to the original radial plot layout sketch in red ink.

Respectfully submitted
/ February 1955

E. L. Williams
E. L. Williams
Carto. Photo. Aid

Approved and Forwarded

E. H. Kirsch, Comdr. USCGS
Officer in Charge
Baltimore Photo. Office

U.S. DEPARTMENT OF COMMERCE
COAST AND GEODETIC SURVEY
DESCRIPTIVE REPORT
CONTROL RECORD

MAP T. 11296 PROJECT NO. 6117 SCALE OF MAP 1:10,000 SCALE FACTOR

STATION	SOURCE OF INFORMATION (INDEX)	DATUM	LATITUDE OR ψ -COORDINATE LONGITUDE OR x -COORDINATE		DISTANCE FROM GRID IN FEET, OR PROJECTION LINE IN METERS		DATUM CORRECTION	N.A. 1927 - DATUM DISTANCE FROM GRID OR PROJECTION LINE IN METERS		FACTOR DISTANCE FROM GRID OR PROJECTION LINE IN METERS
			\circ	'	FORWARD	(BACK)		FORWARD	(BACK)	
PINK, 1907	G 609 p. 243	N.A. 1927	54	59	21.097			652.4	(1203.0)	
			132	50	27.292			485.3	(581.6)	
HEN, 1907	G 609 p. 237	"	54	58	42.544			1315.6	(539.8)	
			132	44	07.821			139.1	(928.0)	
JACK, 1907	"	"	54	58	33.709			1042.4	(813.0)	
			132	43	06.619			117.7	(949.5)	
NICE, 1907	"	"	54	57	54.153			1674.6	(180.8)	
			132	46	33.931			603.7	(463.8)	
SHOE, 1907-25	"	"	54	56	54.214			1676.5	(178.9)	
			132	44	05.631			100.2	(967.8)	
Sub. Pt. HEN, 1907			54	58				1316.1	(539.3)	
			132	44				144.6	(922.5)	
Sub. Pt. JACK, 1907			54	58				1044.2	(811.2)	
			132	43				94.0	(973.2)	
Sub. Pt. GREEN RM, 1907-18			54	58				1360.0	(495.4)	
			132	41				207.1	(860.1)	
Sub. Pt. NICE, 1907			54	57				1665.7	(189.7)	
			132	46				619.0	(448.5)	
Sub. Pt. SHOE, 1907-25			54	56				1684.9	(170.5)	
			132	44				101.2	(966.8)	
GREEN, RM, 1907-18			54	58				1370.8	(484.6)	
			132	41				216.9	(850.3)	

- 8 -

COMPILATION REPORT

T-11296

Field Inspection Report:

1. Photogrammetric Field Inspection Report, SE Alaska, Cordova Bay - Prince of Wales Island, 1953, USC&GS Ship HODGSON, F. R. Gossett, commanding.
2. Photogrammetric Field Inspection Report, SE Alaska, Cordova Bay (T-11293 thru T-11303) 1954, USC&GS Ship HODGSON, J. Bowie, commanding.

Photogrammetric Plot Report:

1. Photogrammetric Plot Report (1954) for surveys T-9435, T-9903, T-11035, T-11293 thru T-11298 ~~which is part of the Descriptive Report for T-9903.~~
2. Supplementary Radial Plot Report (1955) for surveys T-9435, T-11293 and T-11296 ~~which is part of the Descriptive Report for survey T-9435.~~

31. DELINEATION

Graphic methods were used to delineate this manuscript.

The delineation of the area SW of Tlevak Strait was not required at this time.

Originally the delineation was done using ratio prints of U. S. Navy single lens photographs and nine-lens photographs. The quality of the Navy photos was not satisfactory.

The area of Jackson Island was re-delineated from 1954 single lens photography.

32. CONTROL

Refer to the Photogrammetric Plot Reports.

33. SUPPLEMENTAL DATA

Copies of the boat sheets for survey H-8131 (1954) were available for purposes of comparison.

34. CONTOURS AND DRAINAGE

Contours: Not applicable.

Drainage: No comment.

35. SHORELINE AND ALONGSHORE DETAILS

No field inspection was furnished in this area.

The low water line and limits of ledge and foul areas are based on office interpretation of the 1954 photographs which were taken when the tide was below MLLW.

36. OFFSHORE DETAILS

No comment.

37. LANDMARKS AND AIDS

Form 567 was submitted for Tlevak Strait Light.

38. CONTROL FOR FUTURE SURVEYS

There are no recoverable topographic stations in the area of this survey.

Four photo-hydro stations have been located on this manuscript. They are listed in paragraph 49.

39. JUNCTIONS

Junction has been made with survey T-11293 to the north. There is no junction to be made with survey T-11297 to the east. To the south and west are no contemporary surveys.

40. HORIZONTAL AND VERTICAL ACCURACY

See Photogrammetric Plot Reports.

41 - 45

Inapplicable.

46. COMPARISON WITH EXISTING MAPS

The information shown on the USGS Dixon Entrance quadrangle, scale 1:250,000, edition of 1953, is based on U.S.C. & G. S. Charts.

47. COMPARISON WITH NAUTICAL CHARTS

Chart 8147, scale 1:40,000 published August 1931 corrected to 5/12/52.

Items to be applied to nautical charts immediately: None.

Items to be carried forward: None.

Respectfully submitted
25 April 1956

Jack Honick
Jack Honick,
Carto. Photo. Aid

Approved and Forwarded

E. H. Kirsch
E. H. Kirsch,
Capt. C&GS
Baltimore District Officer

August 25, 1970

GEOGRAPHIC NAMES

FINAL NAME SHEET

PH-117 (Alaska)

T-11296

Cordova Bay

Jackson Island

Jackson Passage


Lacey Island

Sukkwan Island

Tlevak Strait


Triplet Rocks

Approved by:

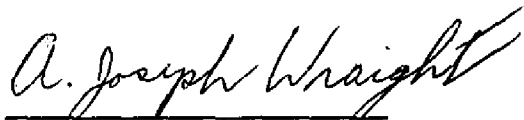

A. Joseph Wraight
Chief Geographer

Prepared by:

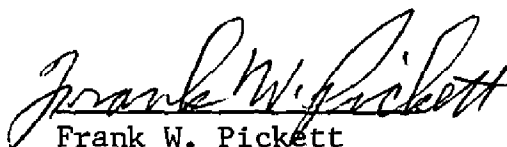

Frank W. Pickett
Cartographic Technician

T-11296

49. NOTES FOR HYDROGRAPHER

The following are the photo-hydro stations located on the manuscript:

BOB
HIS
RAM
RIP

There appears to be a possible obstruction at Lat. $54^{\circ} 59.8'$
Long. $132^{\circ} 45.9'$.

50-

PHOTOGRAMMETRIC OFFICE REVIEW

T-11296

- 1. Projection and grids
- 2. Title
- 3. Manuscript numbers
- 4. Manuscript size

CONTROL STATIONS

4a. Classification label

- 5. Horizontal control stations of third-order or higher accuracy
- 6. ~~Recoverable horizontal stations of less than third order accuracy (topographic stations)~~
- 7. Photo hydro stations
- 8. Bench marks
- 9. ~~Plotting of sextant fixes~~
- 10. Photogrammetric plot report
- 11. Detail points

ALONGSHORE AREAS

(Nautical Chart Data)

- 12. Shoreline
- 13. Low-water line
- 14. Rocks, shoals, etc.
- 15. ~~Bridges~~
- 16. Aids to navigation
- 17. ~~Landmarks~~
- 18. Other alongshore physical features
- 19. ~~Other along shore cultural features~~

PHYSICAL FEATURES

- 20. Water features
- 21. Natural ground cover
- 22. ~~Planetable contours~~
- 23. ~~Stereoscopic instrument contours~~
- 24. ~~Contours in general~~
- 25. ~~Spot elevations~~
- 26. ~~Other physical features~~

CULTURAL FEATURES

- 27. ~~Roads~~
- 28. ~~Buildings~~
- 29. ~~Railroads~~
- 30. ~~Other cultural features~~

BOUNDARIES

- 31. ~~Boundary lines~~
- 32. ~~Public land lines~~

MISCELLANEOUS

- 33. Geographic names
- 34. Junctions
- 35. Legibility of the manuscript
- 36. ~~Discrepancy overlay~~
- 37. Descriptive Report
- 38. ~~Field inspection photographs~~
- 39. Forms

40. R. Glaser
Reviewer

Joseph Steinberg
Supervisor, Review Section of Unit

41. Remarks (see attached sheet)

~~FIELD COMPLETION~~ ADDITIONS AND CORRECTIONS TO THE MANUSCRIPT

42. Additions and corrections furnished by the field ~~completion survey~~ have been applied to the manuscript. The manuscript is now complete except as noted under item 43. Information is not available.

J. B. Phillips and J. Honick
Compiler

FRANK J. TARZA
Supervisor

43. Remarks:

Review Report T-11296
Shoreline Mapping

September 1970

61. General Statement

The registration manuscript copy for T-11296 was made from the negative of the Advanced Manuscript. The original manuscript is lost.

Differences in some rock elevations were found between T-11296 and H-8131 (refer to Summary, "Rock Elevations"). These elevations were removed from T-11296. *page 7*

62. Comparison with Registered Topographic Surveys

Comparison was made with the following topographic surveys:

T-2331, dated 1897, 1:80,000 scale
T-2787, dated 1905, 1:40,000 scale

These surveys are superseded for charting by T-11296.

63. Comparison with Maps of Other Agencies

Comparison was made with USGS Dixon Entrance (D-3), Alaska quadrangle, 1:63,360 scale, dated 1948. No differences of importance were found in the comparison.

64. Comparison with Contemporary Hydrographic Surveys

Photogrammetric survey T-11296 was used as a base for new hydrography. The following hydrographic surveys were used for comparison:

H-8131, dated 1954, 1:10,000 scale
H-8134, dated 1954, 1:20,000 scale

The compilation of T-11296 covers only the area northeast of Tlevak Strait.

The agreement is good between the hydrographic surveys and T-11296.

65. Comparison with Nautical Charts

Comparison was made with chart 8147, 1:40,000 scale, 5th Edition, corrected to July 3, 1967. No significant differences were found in the comparison.

66. Adequacy of Results and Future Surveys

(Refer to Summary, "Map Accuracy.") - page 6

Reviewed by,



Donald M. Brant

Approved by,



Chief, Photogrammetric Branch

DJA



Chief, Photogrammetry Division

DEPARTMENT OF COMMERCE
U. S. COAST AND GEODETIC SURVEY

NONFLOATING AIDS OR LANDMARKS FOR CHARTS

TO BE CHARTED
~~TO BE DELETED~~

STRIKE OUT ONE

Baltimore, Maryland

15 March

1950

I recommend that the following objects which have ~~(XXXXXXXXXX)~~ been inspected from seaward to determine their value as landmarks be charted on ~~(XXXXXXXXXX)~~ the charts indicated.

The positions given have been checked after listing by R. Glaeser

(Signed) E. H. Kirsch

E. H. Kirsch

Chief of Party

CHARTING NAME	STATE	ALASKA	DESCRIPTION	SIGNAL NAME	POSITION				METHOD OF LOCATION AND SURVEY No.	DATE OF LOCATION	HARBOR CHART	INSHORE CHART	OFFSHORE CHART	CHARTS AFFECTED	
					LATITUDE *		LONGITUDE *								DATUM
					° ' "	D. M. METERS	° ' "	D. P. METERS							
					54	57	4.59	132	44	E.A.				1953	
			Tlovak Strait Light				34.89	621		1927					

This form shall be prepared in accordance with Hydrographic Manual, pages 800 to 804. Positions of charted landmarks and nonfloating aids to navigation, if redetermined, shall be reported on this form. The data should be considered for the charts of the area and not by