

13104

13104

<p>Form 504</p> <p>U. S. DEPARTMENT OF COMMERCE</p> <p>COAST AND GEODETIC SURVEY</p> <h2 style="text-align: center;">DESCRIPTIVE REPORT</h2>	
<p>Type of Survey <u>Shoreline</u></p>	
<p>Field No. _____ Office No. <u>T-13104</u></p>	
<p>LOCALITY</p>	
<p>State <u>Florida</u></p>	
<p>General locality <u>Florida Coast</u></p>	
<p>Locality <u>Grant</u></p>	
<p><u>19 66-67</u></p>	
<p>CHIEF OF PARTY</p>	
<p>LIBRARY & ARCHIVES</p>	
<p>DATE _____</p>	

DESCRIPTIVE REPORT - DATA RECORD

T-13104

PROJECT NO. (II): PH-6710			
FIELD OFFICE (III):		CHIEF OF PARTY	
PHOTOGRAMMETRIC OFFICE (III): Washington Science Center		OFFICER-IN-CHARGE V. Ralph Sobieralski	
INSTRUCTIONS DATED (II) (III): Office: April 6, 1967; April 27, 1967			
METHOD OF COMPILATION (III): Stereoscopic - B-8 Stereoplotter			
MANUSCRIPT SCALE (III): 1:20,000		STEREOSCOPIC PLOTTING INSTRUMENT SCALE (III): 20,000	
DATE RECEIVED IN WASHINGTON OFFICE (IV):		DATE REPORTED TO NAUTICAL CHART BRANCH (IV):	
APPLIED TO CHART NO.		DATE:	DATE REGISTERED (IV):
HORIZONTAL DATUM (III): N.A. 1927		VERTICAL DATUM (III): MEAN SEA LEVEL EXCEPT AS FOLLOWS: <i>Elevations shown as (25) refer to mean high water</i> <i>Elevations shown as (5) refer to sounding datum</i> <i>i.e., mean low water or mean lower low water</i>	
REFERENCE STATION (III): VALKARIA, 1960			
LAT.:	LONG.:	<input type="checkbox"/> ADJUSTED <input type="checkbox"/> UNADJUSTED	
PLANE COORDINATES (IV): y = 1,317,016.24 x = 642,669.40		STATE Florida	ZONE East
ROMAN NUMERALS INDICATE WHETHER THE ITEM IS TO BE ENTERED BY (II) FIELD PARTY, (III) PHOTOGRAMMETRIC OFFICE, OR (IV) WASHINGTON OFFICE. WHEN ENTERING NAMES OF PERSONNEL ON THIS RECORD GIVE THE SURNAME AND INITIALS, NOT INITIALS ONLY.			

DESCRIPTIVE REPORT - DATA RECORD

T-13104

FIELD INSPECTION BY (II): (None) see remarks below		DATE:
MEAN HIGH WATER LOCATION (III) (STATE DATE AND METHOD OF LOCATION): Office interpretation Nov. 1966-Feb. 1967 <i>Field edit 12/67</i>		
PROJECTION AND GRIDS RULED BY (IV): A. E. Roundtree	DATE 11-7-66	
PROJECTION AND GRIDS CHECKED BY (IV): R. Glaser	DATE 11-9-66	
CONTROL PLOTTED BY (III): J. Mooney	DATE June 1967	
CONTROL CHECKED BY (III): R. A. Youngblood	DATE June 1967	
RADIAL PLOT OR STEREOSCOPIC CONTROL EXTENSION BY (III): R. Kelly	DATE May-Oct. 1967	
STEREOSCOPIC INSTRUMENT COMPILATION (III): R. A. Youngblood	PLANIMETRY	DATE 7-12-67
	CONTOURS	DATE
MANUSCRIPT DELINEATED BY (III): R. A. Youngblood	DATE 7-18-67	
SCRIBING BY (III):	DATE	
PHOTOGRAMMETRIC OFFICE REVIEW BY (III): J. P. Battley Jr.	DATE May 1969	

REMARKS:

Field Edit by:

W. H. Shearouse - Dec. 1967

DESCRIPTIVE REPORT - DATA RECORD

CAMERA (KIND OR SOURCE) (III):

"L" 6" Focal Length (Color) "S" RC-8 Camera (infra-red)

PHOTOGRAPHS (III)

NUMBER	DATE	TIME	SCALE	STAGE OF TIDE
67S 8242R -8246R	Feb. 24, 1967	9:58	1:40,000	1.7' Above MLW
66L 8762-8766	Nov. 26, 1966	10:18	1:40,000	1.4' Above MLW }*

* based on predicted tides

TIDE (III)

	RATIO OF RANGES	MEAN RANGE	SPRING RANGE
REFERENCE STATION: Miami Harbor Entrance		2.5	3.0
SUBORDINATE STATION: Fort Pierce Inlet (breakwater)		2.6	3.0
SUBORDINATE STATION:			

WASHINGTON OFFICE REVIEW BY (IV):

J. P. BATTLE

DATE:

SEPT 1968

PROOF EDIT BY (IV):

DATE:

NUMBER OF TRIANGULATION STATIONS SEARCHED FOR (II):

RECOVERED:

5

IDENTIFIED:

NUMBER OF BM(S) SEARCHED FOR (II):

RECOVERED:

IDENTIFIED

NUMBER OF RECOVERABLE PHOTO STATIONS ESTABLISHED (III):

NUMBER OF TEMPORARY PHOTO HYDRO STATIONS ESTABLISHED (III):

REMARKS:

Summary to Accompany Descriptive Report
T-13100 through T-13117, T-13141 and
T-13218

PH-6710
December 1969

This project is comprised of thirteen shoreline manuscripts compiled at 1:20,000 scale, (T-13100 through T-13112), four manuscripts compiled at 1:10,000 scale, (T-13113 through T-13115) and three 1:5,000 scale manuscripts, (T-13116 through T-13117). The area covered is the east coast of Florida from Cape Kennedy to just south of Jupiter Inlet. The maps were compiled as a base for hydrographic survey operations and to update marine charts of the area. Two manuscripts, (T-13218 and T-13141) were added to the project after hydro operations were begun and are discussed in this summary.

Field inspection was accomplished during Sept.-Oct. 1966 and was limited to the recovery and premarking of control.

The project area was flown in November 1966. Infrared and color photography was taken.

Stereoplanigraph bridging of the color photography was begun in April 1967 and continued through October 1967. To support hydrographic survey operations, the bridging data was supplied the Washington compilation section as each of nine strips were bridged. Strips #2 through #8 were bridged by stereoplanigraph methods. Strip #1 was bridged analytically. All bridging photography was 1:40,000 scale. Some difficulty was experienced in bridging the project area - (see the Plot Report for details).

The manuscripts were compiled as bridging was received from April 1967 through February 1968. Ratio photographs were prepared in the usual manner for photo-hydro support use. The photographs prepared were both infrared and color. The field ratio prints, cronaflex copies of the manuscripts and discrepancy ozalids were sent to the field, as completed, to expedite hydro activities. Two new manuscripts were added to the project after hydro operations were begun to develop

more of the Loxahatchee River which empties into Jupiter Inlet (T-13141, 1:10,000 scale), and T-13218, 1:5,000 scale to further develop the Ft. Pierce harbor area. This accounts for compilation activities extending to June 1968. In the area of the 1:10,000 scale manuscripts - 1967 1:30,000 scale color and infrared photography was available for compilation. In the area of the two 1:5,000 scale manuscripts (T-13116 and T-13117), 1:15,000 scale color photographs were available. T-13218 (1:5,000 scale) was compiled at 1:10,000 scale on the B-8 stereoplotter from 1:40,000 scale photography and then enlarged to 1:5,000 for a hydro support manuscript. This manuscript is thus considered somewhat substandard in accuracy. All compilation was achieved on the B-8 stereoplotter.

Field edit operations were begun in November 1967 and were completed in 1968. To resolve some landmark and aid problems, provide hydro support, and to further clarify differences in compiled features for Marine Charts, additional field work was accomplished in February 1969. Field edit operations required the location of most of the daybeacons throughout the project area and verification of compiled features.

The application of field edit corrections and/or additions was accomplished in the Washington compilation office as received from the field with some interruption for higher priority projects. Field edit application and final review was completed in November 1969. As field edit corrections were applied to each T-sheet and checked for completeness, a cronaflex copy was ordered for the Marine Chart Division. Hydro verification was being accomplished at the same time of final review and close liaison was maintained between sections.

A Registration Manuscript Copy^{fs} will be registered in the Bureau Archives under their respective T-numbers.


Submitted by,

Jeter P. Battley Jr.

J. P. Battley, Jr.

PROJECT DIAGRAM

INDEX TO ADJOINING SHEETS PH-6710

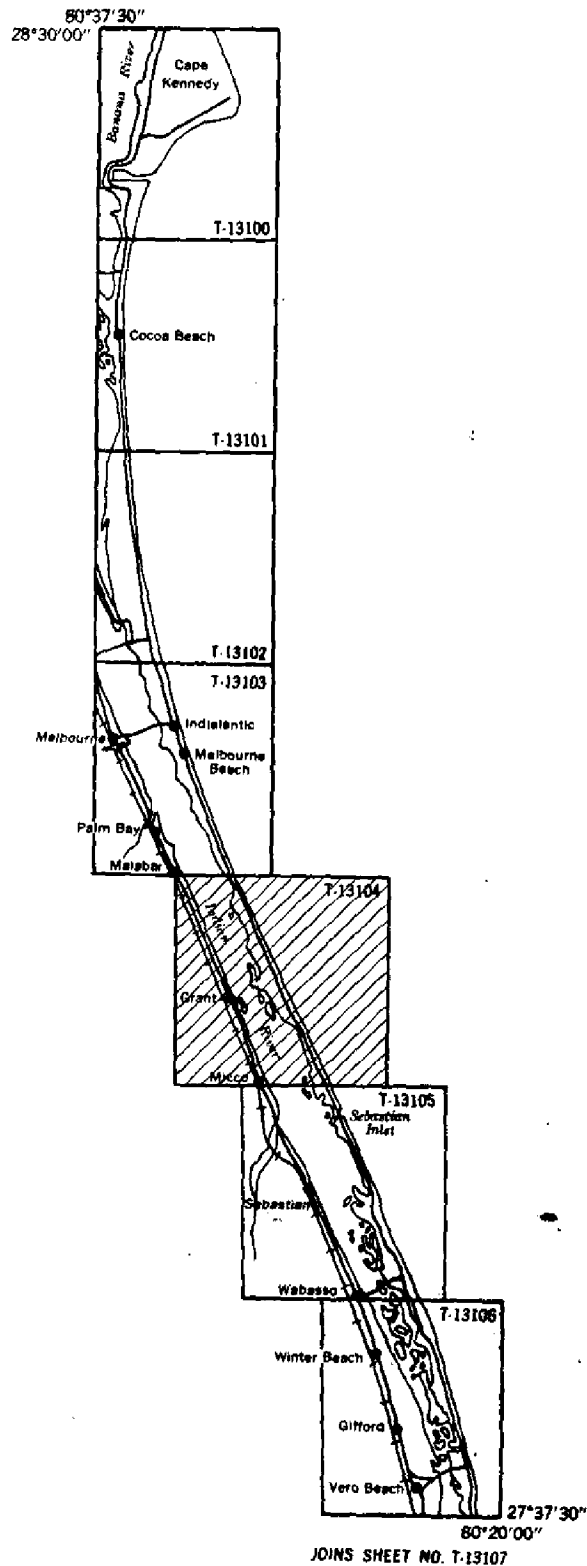

PHOTOGRAMMETRIC PLOT REPORT

Job PH-6710

Cape Kennedy to Jupiter Inlet, Florida

October 27, 1967

21. Area Covered

This report covers the bridging of the Florida east coast from Cape Kennedy to Jupiter Inlet. Included in this area are T-sheets T-13100 thru T-13112 at 1:20,000 scale, T-13113 thru T-13115 and T-13141 at 1:10,000 scale and T-13116, T-13117 and T-13218 at 1:5,000 scale.

22. Method

Eight strips were bridged by stereoplanigraph methods and one strip (Strip #1) by STK methods. All were adjusted by the IBM 1620 method. Strip #1 (66-L(C)-8716 thru 8731) was bridged holding six stations as control and three stations plus tie points as checks. Strip #1-C (66-L(C)-8708 thru 8716) was adjusted holding five control stations with two stations as checks. Strip #2 (66-L-8822 thru 8832) was adjusted on four stations. Strip #3 (66-L(C)-8696 thru 8702) was adjusted on four stations with tie points as checks. Strip #4 (66-L(C)-8738 thru 8748) was adjusted on four stations with tie points as checks. Strip #5 (66-L(C)-8768 thru 8799) was adjusted on five stations with two stations and tie points as checks. Strip #6 (66-L(C)-8782 thru 8797) was adjusted on five control stations with tie points as checks. Strip #7 (66-L(C)-8773 thru 8779) was adjusted on three stations. Strip #8 (66-L(C)-8804 thru 8821) was adjusted on three stations with tie points as checks.

All plates were drilled by the PUG method. Tie points between strips were averaged.

23. Adequacy of Control

Horizontal control complied with project instructions. Most of the control stations were premarked with additional substations selected on color photos taken with a hand-held camera. These photos were used before the strip photography was available. Many of the images selected on the hand-held photographs could not be determined on the strip photography. In some cases the premarked stations could not be seen clearly in the strip photography.

Stations which could not be held within National Map Accuracy Standards and the probable reasons for the source of error are as follows:

STRIP #1

BET, 1967, SS "A" and SS "B" - Could not be clearly seen on the 1:40,000 scale photography.

POLE (TEMP), BASE PT. "C", 1967, Panel, SS "A" and SS "B" - The positions of this station and its substations were determined by a short baseline method. With the small angle involved and the evidence of bridging residuals, this station was treated as a passpoint between Strips #1 and #8.

PIERCE 2, 1963 - Only the 1:40,000 scale target was considered as a good point in Strip #1. All other substations were dropped from the adjustment.

STRIP #2

RADAR, 1955, SS "A" was a very poor image point on this strip and was dropped from the adjustment.

STRIP #5

VALKARIA, 1960 (Target) and TURKEY CREEK, 1877 (Target) gave large residuals in the adjustment phase and were dropped. The substations for these stations were used in place of the targets and showed good residuals in the adjustment.

STRIP #6

TRIPOD 3, 1963, SS "A" - No reason could be determined for this substation not holding in the adjustment. It was dropped from the bridge.

STRIP #7

ARTESIA, 1953, SS "A" - No reason could be determined for the error in this station. Since two companion points held, the substation was dropped.

STRIP #8

POLE (TEMP), BASE PT. "C", 1967 - See note under Strip #1.

24. Supplemental Data

Local USGS quads were used for elevations during bridging operations.

25. Photography

Photography was adequate as to coverage, overlap, definition and quality.



Submitted by:

Robert B. Kelly

Approved by:

John D. Perrow Jr.

PH-6710
FLORIDA COAST

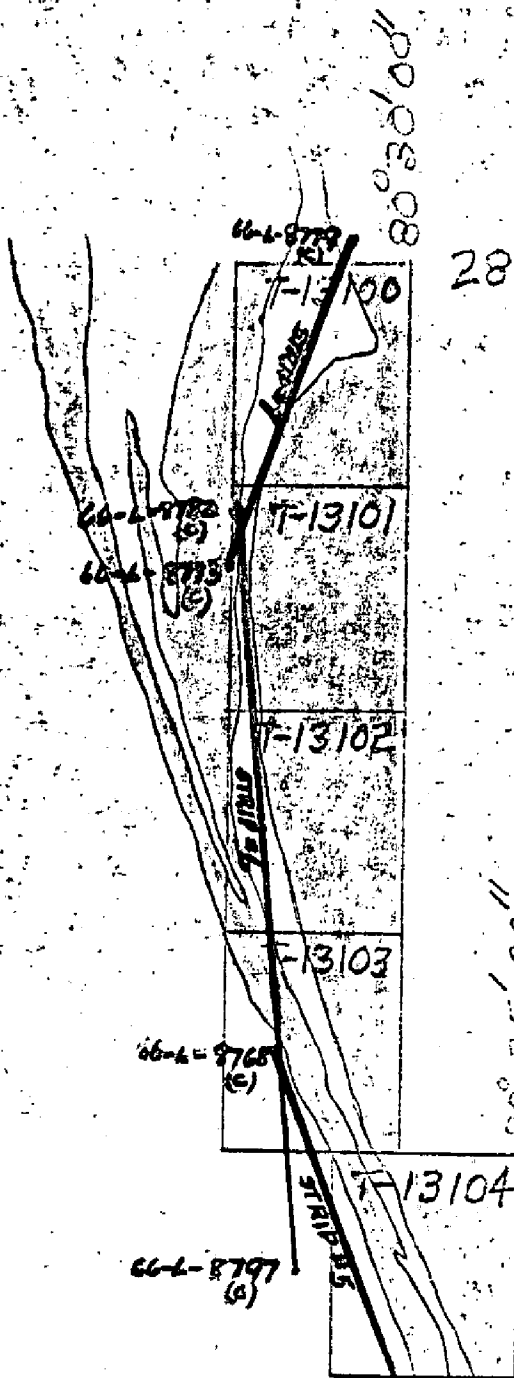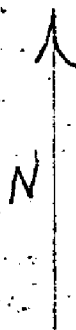

28° 30' 00"

80° 25' 00"

27° 52' 30"

Compilation Report
Project PH-6710
T-13104
July 1967

31. Delineation

This manuscript was compiled on the B-8 stereoplotter at a scale of 1:20,000 using 1:40,000 color plates. Infrared photographs ratioed to manuscript scale were used for a graphic refinement of the MHWL.

Points were positioned along the shoreline to facilitate hydrographic signal location and cronapaque ratio prints of manuscript in the standard manner for photo hydro support.

This manuscript was also delineated according to Marine Chart specifications to provide a new base for Chart 845-SC.

32. Control

Identification, density and placement of control was adequate.

33. Supplemental Data

Small-craft Chart 845-SC at 1:40,000 scale dated August 1966 was used as an aid in locating Lts. and daybeacons in the area. Geological Survey Quads.; Sebastian N. W., Florida, and Grant, Florida, dated 1951 at a scale of 1:24,000 were used for the Geographic Names Standard.

34. Contours and Drainage

Inapplicable

35. Shoreline and Alongshore Details

Delineation of the shoreline and alongshore details was accomplished by office interpretation of the photographs.

36. Offshore Details

No comment.

37. Landmarks and Aids

Thirty-four aids to navigation have been shown on the manuscript.

38. Control for Future Surveys

No comment.

39. Junctions

Junction has been made and is in agreement to the North with T-13103 and to the South with T-13105.

40. Horizontal and Vertical Accuracy

No comment.

41.-45 - Not applicable

46. Comparison with Existing Maps

Comparison has been made with Geological Survey Quads.; Sebastian N. W., Florida, and Grant, Florida, dated 1951 at a scale of 1:24,000.

47. Comparison with Nautical Charts

Comparison has been made with Nautical Charts #1246, scale 1:80,000, revised to 7-15-67 and Chart 845-SC, scale 1:40,000, dated 8-20-66.

Submitted by,

R. A. Youngblood

R. A. Youngblood

Approved by,

K. N. Maki

K. N. Maki
Chief, Compilation Section

GEOGRAPHIC NAMES

FINAL NAME SHEET

PH-6710 (Cape Kennedy to Jupiter Inlet)

T-13104

Atlantic Ocean ✓

Ballard Cove ✓

Ballard Pines ✓

Big Snag Island ✓

East Channel ✓

Evans Pines ✓

Gibbs Point ✓

Grant ✓

Grant Farm Island

Hog Point

Hog Point Cove

Hog Point Creek

Indian River

Intracoastal Waterway

Latham Island ✓

Little Snag Island ✓

Long Point Creek

Mathers Cove

Micco ✓

Middle Banks ✓

Middle Gap ✓

Mud Hole

Mullet Creek ✓

Nancy Creek

Pepper Cove

Pepper Point

Shell Pit Point

Snag Harbor

South Snag Harbor

Trout Creek

Washburn Cove

Approved by:

A. J. Wraight
A. J. Wraight
Chief Geographer

Prepared by:

Frank W. Pickett
Frank W. Pickett
Cartographic Technician

FIELD EDIT REPORT

JOB PH-6710

³
MAPS T-1310~~4~~ and T-13104

In accordance with Instructions - FIELD EDIT - Job PH-6710;
Chart Topography, Cape Kennedy to Jupiter Inlet, Fla. (C1413)

51. METHODS

The mean high-water line along the ocean front was verified by visual inspection and an occasional measured distance from an identifiable object or point, the measurement being recorded on the photograph.

Compiled shoreline along the Indian River was visually verified from a small boat. Requests for corrections, additions and deletions are indicated on the Field Edit Sheet with reference to the photograph by number on which the information is shown.

Streets and roads were travelled to verify existence and classification.

Landmark buildings have been circled on the photographs or verified if compiled.

Landmarks and aids to navigation were visually verified as to existence. A considerable number of daybeacons appeared to be new structures, or in a slightly different position from that compiled. A check was made with the Aids to Navigation officer of the Coast Guard and a list of aids rebuilt since photography obtained. New positions were established by sextant fix where applicable. These have been plotted on the cronaflex print of the map manuscript, the fixes being recorded, and submitted, in a Sketchbook. The plotted positions have not been scaled. Form 567 is submitted for only those aids that have been rebuilt and those that are identified on the photographs (transparencies). Form 567 is submitted for all landmarks.

Additions, deletions and corrections have been noted on the FIELD EDIT SHEET--DISCREPANCY PRINT with cross-referencing to the photographs.

Violet ink was used for all field edit notes.

In addition to the Field Edit Sheet and cronaflex for each map, field edit information will be found on the following photographs: 66L(c)8762 thru 8769, 8791, 8792; infrared rectified photos: 67S8244R and 8245R; color transparencies: 8762, 8763, 8764, 8791, 8792.

52. ADEQUACY OF COMPILATION

After application of field edit corrections, additions and deletions, compilation will be adequate.

53. MAP ACCURACY

No tests were specified. However, a large number of sextant fixes were required to locate daybeacons, piling and stakes. By using compiled objects such as lights, pier ends, gables, etc., the fixes plotted very good, thus proving the horizontal position of the tested features to be accurate.

54. RECOMMENDATIONS

None offered.

55. EXAMINATION OF PROOF COPY

Not required.

submitted 12/1/67

William H. Shearouse
Chief, Photo Party 60

Review Report T-13104
Shoreline Mapping
March 1970

61. General Statement

(See Summary)

62. Comparison with Registered Topographic Surveys

Comparison was made with T-8885 and T-8886, scale 1:20,000 compiled from aerial photographs of December 1947. These surveys are superseded for nautical charting by the new survey. Extensive shoreline changes along the Indian River also make the prior surveys obsolete for shoreline mapping.

63. Comparison with Maps of Other Agencies

See paragraph 46 of Compilation Report.

64. Comparison with Contemporary Hydrographic Surveys

There is no contemporary hydrographic survey in this area. Comparison was made with H-5039, scale 1:40,000 dated 1930.

65. Comparison with Nautical Charts

Comparison was made with Chart 1246, scale 1:80,000, 5th Edition, dated October 7, 1968, and 845-SC, scale 1:40,000, 8th Edition, dated August 30, 1969. All differences noted on the discrepancy print between the published charts and the new survey were resolved in field edit. The discrepancy print was prepared in 1967 and was compared with the latest editions of the above charts at that time. Additional piling along the western shore of the Indian River located in field edit may be of interest in small-craft charting.

66. Adequacy of Results and Future Surveys

T-13104 complies with the project instructions and is within the National Standards of Accuracy.

Reviewed by,

Peter P. Battley Jr.

Approved by,

R. J. [Signature]
Chief, Photogrammetry Division

Charles [Signature]
Chief, Marine Chart Division

Photogrammetric Branch

105

DESCRIPTIVE REPORT CONTROL RECORD

MAP T- 13104 PROJECT NO. PH-6710 SCALE OF MAP _____ SCALE FACTOR _____

STATION	SOURCE OF INFORMATION (INDEX)	DATUM	LATITUDE OR Y COORDINATE LONGITUDE OR X COORDINATE	DISTANCE FROM GRID OR PROJECTION LINE IN METERS (1 Ft. = 3048006 meter) FORWARD (BACK)
SHORT, 3, 1948			1,327,501.58	
VAIKARIA, 1960			655,722.77	
GRANT, 1930			1,317,016.24	
EVANS 2, 1934			642,669.40	
SLIP 2, 1934			1,304,251.73	
			655,156.34	
			1,299,567.11	
			669,602.42	
			1,291,754.53	
			673,792.03	

COMPUTED BY _____ DATE _____ CHECKED BY _____ DATE _____

NONFLOATING AIDS OR LANDMARKS FOR CHARTS

TO BE CHARTED
~~TO BE REVISED~~
~~TO BE DELETED~~ } STRIKE OUT TWO

Rockville, Md. Nov. 4 19 68

I recommend that the following objects which have ~~been~~ been inspected from seaward to determine their value as landmarks be charted on ~~the~~ the charts indicated.

The positions given have been checked after listing by R. A. Youngblood

V. Ralph Sobieralski

Chief of Party.

CHARTING NAME	STATE	DESCRIPTION	SIGNAL NAME	POSITION				METHOD OF LOCATION AND SURVEY No.	DATE OF LOCATION	HARBOR CHART	INSHORE CHART	OFFSHORE CHART	CHARTS AFFECTED	
				LATITUDE*		LONGITUDE*								DATUM
				° /	'	° /	'							
	Florida													
		Intracoastal Waterway												
		Eau Gallie-St. Lucie Inlet												
Dybn 20		Indian River (South Section)		27 59	31.3	80 32	29.2	NA	11/20/67	X		845-SC		
Lt 21		"		27 59	963.5	80 32	797.8	1927	"	X		"		
Dybn 22		"		27 59	27.3	80 32	24.4	"	"	X		"		
Dybn 23		"		27 59	840.5	80 32	666.7	"	"	X		"		
Dybn 24		"		27 59	21.4	80 32	25.0	"	"	X		"		
Dybn 25		"		27 58	658.7	80 32	683.1	"	"	X		"		
Dybn 27		"		27 58	59.9	80 32	17.8	"	"	X		"		
Lt 28		"		27 58	1843.8	80 32	486.3	"	"	X		"		
Dybn 29		"		27 58	29.6	80 32	12.8	"	"	X		"		
Dybn 31		"		27 58	911.1	80 31	349.8	"	"	X		"		
Dybn 32		"		27 58	04.2	80 32	04.5	"	"	X		"		
Lt 33		"		27 57	129.3	80 31	123.0	"	"	X		"		
Dybn 34		"		27 57	37.2	80 31	58.6	"	11/14/67	X		"		
		"		27 57	1145.1	80 31	1600.1	"	"	X		"		
		"		27 57	32.6	80 31	59.5	"	"	X		"		
		"		27 57	1003.5	80 31	1626.5	"	"	X		"		
		"		27 57	27.7	80 31	58.1	"	"	X		"		
		"		27 57	852.7	80 31	1588.2	"	"	X		"		
		"		27 57	09.2	80 31	45.3	"	"	X		"		
		"		27 56	283.2	80 31	1238.3	"	"	X		"		
		"		27 56	47.2	80 31	36.6	"	"	X		"		
		"		27 56	1452.9	80 31	1000.6	"	"	X		"		
		"		27 56	43.7	80 31	32.4	"	"	X		"		
		"		27 56	1345.2	80 31	885.8	"	"	X		"		
		"		27 56	38.9	80 31	33.7	"	"	X		"		
		"		27 56	1197.4	80 31	921.4	"	"	X		"		

This form shall be prepared in accordance with Hydrographic Manual, Publication 20.2, Sec. 1-55, 2-39, 6-36, 7-18 to 22 inclusive, and Fig. 79. Positions of charted landmarks and nonfloating aids to navigation, if redetermined, shall be reported on this form. Revisions shall show both the old and new positions. The data should be considered for the charts of the area and not by individual field survey sheets. Information under each column heading should be given.

* TABULATE SECONDS AND METERS

NONFLOATING AIDS OR LANDMARKS FOR CHARTS

TO BE CHARTED
~~TO BE REVISED~~
~~TO BE DELETED~~ } STRIKE OUT TWO

Rockville, Md. Nov. 4 19 68

I recommend that the following objects which have ~~been~~ been inspected from seaward to determine their value as landmarks be charted on ~~the~~ the charts indicated.

The positions given have been checked after listing by R. A. Youngblood

V. Ralph Sobieralski

Chief of Party

CHARTING NAME	STATE	DESCRIPTION	SIGNAL NAME	POSITION				METHOD OF LOCATION AND SURVEY No.	DATE OF LOCATION	HARBOR CHART	INSHORE CHART	OFFSHORE CHART	CHARTS AFFECTED	
				LATITUDE*		LONGITUDE*								DATUM
				° ' "	D.M. METERS	° ' "	D.P. METERS							
	Florida	Intracoastal Waterway Eau Gallie-St. Lucie Inlet												
Dybn 35		Indian River (South Section)		27 56	12.9	80 31	26.0	NA	11/14/67	X		845-SC		
Dybn 36		"		27 55	58.2	80 31	25.3	"	11/30/67	X		"		
Dybn 37		"		27 55	45.8	80 31	21.0	"	11/14/67	X		"		
Lt 38		"		27 55	39.9	80 31	21.2	"	"	X		"		
Dybn 39		"		27 55	1228.2	80 31	579.7	"	"	X		"		
Dybn 40		"		27 55	36.5	80 31	16.6	"	"	X		"		
Lt 41		"		27 55	1123.5	80 31	453.9	"	"	X		"		
Dybn 42		"		27 55	20.2	80 31	05.7	"	"	X		"		
Dybn 43		"		27 54	621.8	80 31	155.9	"	11/13/67	X		"		
Lt 44		"		27 54	17.2	80 31	00.6	"	"	X		"		
Dybn 45		"		27 55	11.9	80 31	01.3	"	"	X		"		
Dybn 47		"		27 55	366.3	80 31	35.5	"	"	X		"		
Lt 48		"		27 54	49.5	80 30	53.6	"	"	X		"		
		"		27 54	1523.7	80 30	1465.5	"	"	X		"		
		"		27 54	44.4	80 30	53.8	"	"	X		"		
		"		27 54	1366.7	80 30	1471.3	"	"	X		"		
		"		27 54	41.4	80 30	49.4	"	"	X		"		
		"		27 54	1274.4	80 30	1351.0	"	"	X		"		
		"		27 54	17.0	80 30	32.9	"	"	X		"		
		"		27 54	523.3	80 30	899.7	"	"	X		"		
		"		27 54	11.7	80 30	30.9	"	"	X		"		
		"		27 54	359.9	80 30	845.1	"	"	X		"		

This form shall be prepared in accordance with Hydrographic Manual, Publication 20.2, Sec. 1-55, 2-39, 6-36, 7-18 to 22 inclusive, and Fig. 79. Positions of charted landmarks and nonfloating aids to navigation, if redetermined, shall be reported on this form. Revisions shall show both the old and new positions. The data should be considered for the charts of the area and not by individual field survey sheets. Information under each column heading should be given.

* TABULATE SECONDS AND METERS

NONFLOATING AIDS AND LANDMARKS FOR CHARTS

TO BE CHARTED
~~TO BE REVISED~~
~~XXXXXXXXXX~~ } STRIKE OUT TWO

Rockville, Md. Nov. 4 19 68

I recommend that the following objects which have ~~been~~ been inspected from seaward to determine their value as landmarks be charted on ~~charts~~ the charts indicated.

The positions given have been checked after listing by R. A. Youngblood

V. Ralph Sobieralski
Chief of Party

CHARTING NAME	STATE	DESCRIPTION	SIGNAL NAME	POSITION				METHOD OF LOCATION AND SURVEY NO.	DATE OF LOCATION	HARBOR CHART	INSHORE CHART	OFFSHORE CHART	CHARTS AFFECTED	
				LATITUDE*		LONGITUDE*								DATUM
				D. M. METERS	"	D. M. METERS	"							
	Florida													
		Intracoastal Waterway												
		Eau Gallie-St. Lucie Inlet												
Dybn 49		Indian River (South Section)		27 54	10.1	80 30	683.7	1927	NA				845-SC	
Dybn 50		"		27 53	59.6	80 30	306.4	"	"				"	
Lt 51		"		27 53	58.8	80 30	161.4	"	"				"	
Dybn 51A		"		27 53	36.1	80 29	416.9	"	"				"	
Dybn 52		"		27 53	53.5	80 30	144.9	"	"				"	
Lt 53		"		27 53	17.2	80 29	39.8	"	"				"	
Dybn 54		"		27 53	529.4	80 29	1088.6	"	"				"	
Dybn 55		"		27 52	16.2	80 29	41.7	"	"				"	
				27 52	37.3	80 29	19.9	"	"				"	
					1148.1	80 29	544.4	"	"				"	

This form shall be prepared in accordance with Hydrographic Manual, Publication 20.2, Sec. 1-55, 2-39, 6-36, 7-18 to 22 inclusive, and Fig. 79. Positions of charted landmarks and nonfloating aids to navigation, if redetermined, shall be reported on this form. Revisions shall show both the old and new positions. The data should be considered for the charts of the area and not by individual field survey sheets. Information under each column heading should be given.

* TABULATE SECONDS AND METERS

NONFLOATING AIDS AND LANDMARKS FOR CHARTS

X1188 CHARTS
X1188 REVISED
TO BE DELETED

STRIKE OUT TWO

Vero Beach, Fla. Nov. 30 19 67

I recommend that the following objects which have ~~been~~ been inspected from seaward to determine their value as landmarks be ~~deleted~~ (deleted from) the charts indicated.

The positions given have been checked after listing by Dennis E. Dearborn

William H. Shearouse

Chief of Party

CHARTING NAME	STATE	DESCRIPTION	SIGNAL NAME	POSITION				METHOD OF LOCATION SURVEY NO.	DATE OF LOCATION	HARBOR CHART	INSHORE CHART	OFFSHORE CHART	CHARTS AFFECTED	
				LATITUDE*		LONGITUDE*								DATUM
				D. M. METERS	//	D. P. METERS	//							
Daybn 54A	FLORIDA	INTRACOASTAL WATERWAY EAU GALIE - ST LUCIE INLET		27 53.0		80 29.6		N. A. 1927	11/30/67	X		845-SG		
		(Daybeacon 54A does not exist)												

This form shall be prepared in accordance with Hydrographic Manual, Publication 20.2, Sec. I-55, 2-59, 6-36, 7-18 to 22 inclusive, and Fig. 79. Positions of charted landmarks and nonfloating aids to navigation, if redetermined, shall be reported on this form. Revisions shall show both the old and new positions. The data should be considered for the charts of the area and not by individual field survey sheets. Information under each column heading should be given.

RECORD OF APPLICATION TO CHARTS

FILE WITH DESCRIPTIVE REPORT OF SURVEY NO. _____

INSTRUCTIONS

A basic hydrographic or topographic survey supersedes all information of like nature on the uncorrected chart.

1. Letter all information.
2. In "Remarks" column cross out words that do not apply.
3. Give reasons for deviations, if any, from recommendations made under "Comparison with Charts" in the Review.

CHART	DATE	CARTOGRAPHER	REMARKS
1246	1/27/72	<i>Z.M. Schantz</i>	Full XXXXXXXXXX After Verification Review Inspection Signed Via Drawing No. 23 - Examined - considered full appl.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.